



IDE30 Series

Analog Input Process Meter



User Manual

Warnings, Warranty, and Configuration Software

Disclaimer

The information contained in this document is subject to change without notice. NOSHOK makes no representations or warranties with respect to the contents hereof and specifically disclaims any implied warranties of merchantability or fitness for a particular purpose. See Warranty Information and Terms & Conditions on www.noshok.com for complete details.



CAUTION

Read complete instructions prior to installation and operation of the meter.



WARNINGS

Risk of electric shock or personal injury.

This product is not recommended for life support applications or applications where malfunctioning could result in personal injury or property loss. Anyone using this product for such applications does so at his/her own risk. NOSHOK shall not be held liable for damages resulting from such improper use.

 **WARNING** Cancer and Reproductive Harm - www.P65Warnings.ca.gov

Limited Warranty

NOSHOK warrants this product against defects in material or workmanship for the specified period under "Specifications" from the date of shipment from the factory. NOSHOK's liability under this limited warranty shall not exceed the purchase value, repair, or replacement of the defective unit. See Warranty Information and Terms & Conditions on noshok.com/support/warranty-information/ for complete details.

Registered Trademarks

All trademarks mentioned in this document are the property of their respective owners.

© 2024 NOSHOK. All rights reserved.

Warnings, Warranty, and Configuration Software

FREE Configuration Software

*The meter can be powered from the USB connection. When using the USB connection, **DO NOT** apply AC or DC power to the meter.*

The easiest and quickest way to program your IDE30 meter is to use the FREE Configuration Software. This software is loaded into the meter and connects and installs directly to your PC with a USB cable. We recommend that the first thing you do after taking the meter out of the box is connect the IDE30 to your PC with the provided USB cable – do not use a different cable. **DO NOT** apply AC or DC power to the meter while your PC is connected to the meter as it will disrupt the USB connection. You don't even have to apply an input signal.

The Configuration Software is intuitive, and most customers can get their meter programmed as they like without even looking in the manual.

Once your meter is programmed the way you want it, you can wire it up for your application per the instructions in this manual and install it. If you find that you need to make adjustments to the programming after the meter is installed, you can use the front panel buttons and the instructions in this manual to do so.



Table of Contents

Introduction.....	9
Ordering Information.....	10
Specifications	11
General.....	11
Process Input	14
Relays	16
Isolated 4-20 mA Transmitter Output	17
USB Connection.....	18
On-Board Digital Input (F4)	18
Configuration Software	18
Safety	19
Electromagnetic Compatibility	19
EU Declaration of Conformity.....	20
Safety Information	21
Unpacking.....	22
Panel Mounting Instructions.....	22
Mounting Dimensions	24
Installation Overview	26
Programming Software.....	26
Configuration Software Installation	27
Transmitter Supply Voltage Selection (P+, P-)	30
Connections.....	31
Connectors Labeling.....	32
Power Connections	35
Signal Connections.....	36
Relay Connections	38
Switching Inductive Loads	39
F4 Digital Input Connections.....	40

Table of Contents

4-20 mA Output Connections	41
Analog Output Power Supply	41
Setup and Programming	42
Overview	42
Front Panel Buttons and Status LED Indicators	43
Display Functions & Messages	45
Main Menu	49
Setting Numeric Values	50
Setting Up the Meter (SETUP)	51
Setting the Input Signal (INPUT)	52
Setting the Display Units or Custom Tags (units)	53
Setting the Decimal Point (DEC Pt)	54
Programming the Meter (PROG)	55
Setting the Display Parameter & Intensity (DISPLAY)	61
Display Intensity (display)	62
Setting the Relay Operation (RELAY)	65
Setting the Relay Action	67
Programming Set and Reset Points	68
Setting Fail-Safe Operation	68
Programming Time Delay	69
Relay Action for Loss of 4-20 mA Input (Loop Break)	69
Relay and Alarm Operation Diagrams	71
High Alarm Operation (Set > Reset)	71
Low Alarm Operation (Set < Reset)	72
High Alarm with Fail-Safe Operation (Set > Reset)	73
Low Alarm with Fail-Safe Operation (Set < Reset)	74
Time Delay Operation	75
Pump Alternation Control Operation	76
Relay Sampling Operation	77

Table of Contents

Relay Operation Details.....	78
Overview.....	78
Relays Auto Initialization.....	78
Fail-Safe Operation	79
Front Panel LEDs	80
Latching and Non-Latching Relay Operation	81
Non-Latching Relay (Relay).....	82
Non-Latching Relay with Manual Reset (Relay)	82
Latching Relay (Relay).....	83
Latching Relay with Clear (Relay).....	83
Acknowledging Relays	84
Pump Alternation Control Applications (Relay).....	84
Scaling the 4-20 mA Analog Output (Relay)	89
Reset Menu (Reset)	89
Manual Control Menu (Control)	90
Setting Up the Password (PASS)	91
Protecting or Locking the Meter.....	91
Making Changes to a Password Protected Meter.....	91
Disabling Password Protection	92
Advanced Features Menu.....	93
Advanced Features Menu & Display Messages	93
Noise Filter (Filter)	96
Noise Filter Bypass (bypass)	96
Rounding Feature (round).....	97
Select Menu (Select)	98
Input Signal Conditioning (Function)	99
Low-Flow Cutoff (LowFlow)	102
Analog Output Programming (RelayPr).....	103
Programmable Function Keys User Menu (User).....	105
Internal Source Calibration (Internal).....	108

Table of Contents

Meter Operation	112
Front Panel Buttons Operation	112
Function Keys Operation	113
F4 Operation.....	113
Maximum/Minimum Readings.....	114
Troubleshooting	115
Diagnostics Menu (d,RL)	115
Testing the Display LEDs	115
Determining Software Version	116
Reset Meter to Factory Defaults	117
Factory Defaults & User Settings.....	118
Troubleshooting Tips	121

Table of Figures

Figure 1. 1/8 DIN Panel Cutout Dimensions	23
Figure 2. Panel Mounting Details	23
Figure 3. Meter Dimensions - Side View	24
Figure 4. Meter Dimensions - Top View	25
Figure 5. Transmitter Supply Voltage Selection	30
Figure 6. IDE30-A-#-2-0 Connectors Label	32
Figure 7. IDE30-A-#-2-1 Connectors Label	32
Figure 8. IDE30-A-#-2-2 Connectors Label	33
Figure 9. IDE30-A-#-2-3 Connectors Label	33
Figure 10. IDE30-A-#-2-4 Connectors Label	34
Figure 11. IDE30-A-#-2-5 Connectors Label	34
Figure 12. Power Connections	35
Figure 13. Transmitters Powered by Internal Supply	36
Figure 14. Transmitter Powered by External Supply or Self-Powered.....	36
Figure 15. Voltage Input Connections	37
Figure 16. Relay Connections	38
Figure 17. AC and DC Loads Protection.....	39
Figure 18. Low Voltage DC Loads Protection	40
Figure 19. F4 Digital Input Connections	40
Figure 20. 4-20 mA Output Connections	41
Figure 21. Analog Output Supply Powering Other Devices.....	41

Introduction

Introduction

Front, back and in between, the IDE30 meter boasts specifications, features and functionality that make it the only 1/8 DIN process meter you will ever need. The number one feature that makes the IDE30 such a useful device is its built-in 24 VDC @ 200 mA power supply to drive the transmitter. This feature not only saves the cost of an external power supply, but also greatly simplifies wiring. In addition, there is a second 24 VDC @ 40 mA power supply provided with the 4-20 mA output option.

Another reason why the IDE30 Meter is the only process meter you will ever need is its NEMA 4X rated front panel. This means you can install the IDE30 in panels exposed to moisture, dust and other adverse conditions. The IDE30 also comes with a SunBright display which means you can install and read the IDE30 in direct sunlight. The next thing to notice is the 6-digit dual-line display that can display numbers up to 999,999 on the upper line and show either a tag or the input in a different scale on the lower line.

Other key features include four relays and 4-20 mA output option, advanced input signal conditioning like automatic round horizontal tank linearization, function keys, and pump alternation capability. Finally, all these features and capabilities can easily be programmed with free PC-based software.

Ordering Information

Ordering Information

85-265 VAC Model	12-24 VDC Model	Options Installed
IDE30-A-1-2-0	IDE30-A-2-2-0	No options
IDE30-A-1-2-1	IDE30-A-2-2-1	2 relays
IDE30-A-1-2-2	IDE30-A-2-2-2	4-20 mA output
IDE30-A-1-2-3	IDE30-A-2-2-3	4 relays
IDE30-A-1-2-4	IDE30-A-2-2-4	2 relays & 4-20 mA output
IDE30-A-1-2-5	IDE30-A-2-2-5	4 relays & 4-20 mA output

Replacement Option Cards

Model	Options Installed
IDE30-x-x-x-1	2 relays
IDE30-x-x-x-2	4-20 mA output
IDE30-x-x-x-3	4 relays
IDE30-x-x-x-4	2 relays & 4-20 mA output
IDE30-x-x-x-5	4 relays & 4-20 mA output

Specifications

Specifications

Except where noted all specifications apply to operation at +25°C.

General

Display	Line 1: 0.60" (15 mm) high, red LEDs, Line 2: 0.46" (12 mm) high, red LEDs 6 digits each (-99999 to 999999), with lead zero blanking
Display Intensity	Eight user selectable intensity levels. Default value is six.
Display Update Rate	5/second (200 ms)
LED Status Indicators	See <i>Front Panel Buttons and Status LED Indicators</i> on page 43 for details.
Overrange	Display flashes 999999
Underrange	Display flashes -99999
Display Assignment	Display Line 1: PV1, PV2, PCT, PV & units, gross weight, net & gross weight, max/min, max & min, or set points. Display Line 2: Same as Display Line 1; plus units, tag or turned off.
Programming Methods	Four front panel buttons, F4 digital input, or PC and Configuration software.
Noise Filter	Programmable from 2 to 199 (0 will disable filter)
Filter Bypass	Programmable from 0.1 to 99.9% of calibrated span
Recalibration	All ranges are calibrated at the factory. Recalibration is recommended at least every 12 months.
Max/Min Display	Max/min readings reached by the process are stored until reset by the user or until power to the meter is turned off.

Specifications

Rounding	Select 1, 2, 5, 10, 20, 50, or 100 (e.g. rounding = 10, value = 123.45, display = 123.50).
Tare	Tare function zeros out the meter to remove the weight of a container. Tare function can be assigned to a function key, or F4 digital input.
Password	Three programmable passwords restrict modification of programmed settings. Pass 1: Allows use of function keys and F4 digital input Pass 2: Allows use of function keys, F4 digital input, and editing set/reset points Pass 3: Restricts all programming, function keys, and F4 digital input.
Non-Volatile Memory	All programmed settings are stored in non-volatile memory for a minimum of ten years if power is lost.
Power Options	85-265 VAC 50/60 Hz; 90-265 VDC, 20 W max; 12-24 VDC, 12-24 VAC, 15 W max. Powered over USB for configuration only.
Fuse	Required external fuse: UL Recognized, 5 A max, slow blow; up to 6 meters may share one 5 A fuse
Normal Mode Rejection	Greater than 60 dB at 50/60 Hz
Isolation	4 kV input/output-to-power line 500 V input-to-output or output-to-P+ supply
Overvoltage Category	Installation Overvoltage Category II: Local level with smaller transient overvoltages than Installation Overvoltage Category III.
Environmental	Operating temperature range: -40 to 65°C (-40 to 149°F) Storage temperature range: -40 to 85°C (-40 to 185°F) Relative humidity: 0 to 90% non-condensing
Connections	Removable screw terminal blocks accept 12 to 22 AWG wire.
Enclosure	1/8 DIN, high impact plastic, UL 94V-0, color: black
Front Panel	NEMA 4X, IP65
Mounting	1/8 DIN panel cutout required: 3.622" x 1.772" (92 mm x 45 mm) Two panel mounting bracket assemblies are provided.

Specifications

Tightening Torque	Screw terminal connectors: 5 lb-in (0.56 Nm)
Overall Dimensions	4.68" x 2.45" x 5.64" (119 mm x 62 mm x 143 mm) (W x H x D)
Weight	9.5 oz (269 g)
Warranty	3 years parts & labor.

Specifications

Process Input

Inputs	Field selectable: 0-20 mA, 4-20 mA ±10 V (0-5 V, 1-5 V, 0-10 V)	
Isolated Transmitter Power Supply	Terminals P+ & P-: 24 VDC ±10%. All models selectable for 24, 10, or 5 VDC supply (internal jumper J4). 85-265 VAC models rated @ 200 mA max, 12-24 VDC powered models rated @ 100 mA max. 5 & 10 VDC supply rated @ 50 mA max. Refer to <i>Transmitter Supply Voltage Selection (P+, P-)</i> on page 30.	
Accuracy	±0.03% of calibrated span ±1 count, square root & programmable exponent accuracy range: 10-100% of calibrated span	
Temperature Drift	0.005% of calibrated span/°C max from 0 to 65°C ambient, 0.01% of calibrated span/°C max from -40 to 0°C ambient	
Input Signal Conditioning	Linear, square root, programmable exponent, or round horizontal tank volume calculation	
Multi-Point Linearization	2 to 32 points for PV or PV1 2 to 8 points for PV2 (Dual-scale Level feature)	
Programmable Exponent	User selectable from 1.0001 to 2.9999 for open channel flow	
Round Horizontal Tank	Diameter & Length: 999.999 inch or cm calculates volume in gallons or liters respectively.	
Low-Flow Cutoff	0.1 to 999,999 (0 disables cutoff function). Point below at which display always shows zero.	
Decimal Point	Up to five decimal places or none: <i>dddddd</i> , <i>ddddd</i> , <i>dddd</i> , <i>ddd</i> , <i>dd</i> , or <i>dddddd</i>	
Calibration Range	Input Range	Minimum Span Input 1 & 2
	4-20 mA	0.15 mA
	±10 V	0.10 V
	An error message will appear if the input 1 and input 2 signals are too close together.	

Specifications

Input Impedance	Voltage ranges: greater than 500 k Ω Current ranges: 50 - 100 Ω (depending on internal resettable fuse impedance)
Input Overload	Current input protected by an internal resettable fuse, 30 VDC max. Fuse resets automatically after fault is removed.
HART Transparency	The meter does not interfere with existing HART communications; it displays the 4-20 mA primary variable and it allows the HART communications to pass through without interruption. The meter is not affected if a HART communicator is connected to the loop. The meter does not display secondary HART variables.

Specifications

Relays

Rating	2 or 4 SPDT (Form C) internal and/or 4 SPST (Form A) external; rated 3 A @ 30 VDC and 125/250 VAC resistive load; 1/14 HP (≈ 50 W) @ 125/250 VAC for inductive loads
Noise Suppression	Noise suppression is recommended for each relay contact switching inductive loads. See <i>Switching Inductive Loads</i> on page 39 for details.
Deadband	0-100% of span, user programmable
High or Low Alarm	User may program any alarm for high or low trip point. Unused alarm LEDs and relays may be disabled (turn off).
Relay Operation	<ul style="list-style-type: none">• Automatic (non-latching) and/or manual reset• Latching (requires manual acknowledge) with or without clear• Pump alternation control (2-4 relays)• Sampling (based on set point and time)• Off (disable unused relays)• Manual on/off control mode
Relay Reset (Acknowledge)	User selectable via front panel button, or F4 terminal at back of meter.
Time Delay	0 to 999.9 seconds, on & off relay time delays. Programmable and independent for each relay
Fail-Safe Operation	Programmable and independent for each relay. <i>Note: Relay coil is energized in non-alarm condition. In case of power failure, relay will go to alarm state.</i>
Auto Initialization	When power is applied to the meter, relays will reflect the state of the input to the meter.

Specifications

Isolated 4-20 mA Transmitter Output

Output Source	Process variable (PV), max, min, set points 1-4, or manual control mode		
Scaling Range	1.000 to 23.000 mA for any display range		
Calibration	Factory calibrated: 4.000 to 20.000 = 4-20 mA output		
Analog Out Programming	23.000 mA maximum for all parameters: Overrange, underrange, max, min, and break		
Accuracy	$\pm 0.1\%$ of span ± 0.004 mA		
Temperature Drift	0.4 $\mu\text{A}/^{\circ}\text{C}$ max from 0 to 65°C ambient, 0.8 $\mu\text{A}/^{\circ}\text{C}$ max from -40 to 0°C ambient <i>Note: Analog output drift is separate from input drift.</i>		
Isolated Transmitter Power Supply	Terminals I+ & R: 24 VDC $\pm 10\%$. May be used to power the 4-20 mA output or other devices. All models rated @ 40 mA max.		
External Loop Power Supply	35 VDC maximum		
Output Loop Resistance	Power supply	Minimum	Maximum
	24 VDC	10 Ω	700 Ω
	35 VDC (external)	100 Ω	1200 Ω

Specifications

USB Connection

Function	Programming only
Compatibility	USB 2.0 Standard, Compliant
Connector Type	Micro-B receptacle
Cable	USB A Male to Micro-B Cable
Driver	Microsoft® Windows® 10/11
Power	USB port provides power to the meter. <u>DO NOT</u> apply AC or DC power to the meter while the USB port is in use.

On-Board Digital Input (F4)

Function	Remote operation of front-panel buttons, acknowledge/reset relays, reset max/min values. See <i>Function Keys & F4 Digital Input Available Settings</i> on page 105 for a complete list of capabilities.
Contacts	3.3 VDC on contact. Connect normally open contacts across F4 to COM
Logic Levels	Logic High: 3 to 5 VDC Logic Low: 0 to 1.25 VDC

Configuration Software

Availability	Download directly from meter or from noshok.com
System Requirements	Microsoft® Windows® 10/11
Communications	USB 2.0 (for programming only) (Standard USB A to Micro USB B)
Configuration	Configure meters one at a time
Power	USB port provides power to the meter. <u>DO NOT</u> apply AC or DC power to the meter while the USB port is in use.

Compliance Information

Safety

UL & C-UL Listed	USA & Canada UL 508 Industrial Control Equipment
UL File Number	E540504
Front Panel	UL Type 4X, NEMA 4X, IP65; panel gasket provided
Low Voltage Directive	EN 61010-1 Safety requirements for measurement, control, and laboratory use

Electromagnetic Compatibility

Emissions	EN 55022 Class A ITE emissions requirements
Radiated Emissions	Class A
AC Mains Conducted Emissions	Class A
Immunity	EN 61326-1 Measurement, control, and laboratory equipment EN 61000-6-2 EMC heavy industrial generic immunity standard
RFI - Amplitude Modulated	80 -1000 MHz 10 V/m 80% AM (1 kHz) 1.4 - 2.0 GHz 3 V/m 80% AM (1 kHz) 2.0 - 2.7 GHz 1 V/m 80% AM (1 kHz)
Electrical Fast Transients	±2kV AC mains, ±1kV other
Electrostatic Discharge	±4kV contact, ±8kV air
RFI - Conducted	10V, 0.15-80 MHz, 1kHz 80% AM

Compliance Information

AC Surge	±2kV Common, ±1kV Differential
Surge	1KV (CM)
Power-Frequency Magnetic Field	30 A/m 70%V for 0.5 period
Voltage Dips	40%V for 5 & 50 periods 70%V for 25 periods
Voltage Interruptions	<5%V for 250 periods

Note:
Testing was conducted on meters installed through the covers of grounded metal enclosures with cable shields grounded at the point of entry representing installations designed to optimize EMC performance.

EU Declaration of Conformity

For reference, a Declaration of Conformity is available on our website www.noshok.com.

Safety Information

Safety Information



CAUTION

Read complete instructions prior to installation and operation of the meter.



WARNINGS

Risk of electric shock or personal injury.

Hazardous voltages exist within enclosure. Installation and service should be performed only by trained service personnel.

Installation and Unpacking

Installation

There is no need to remove the meter from its case to complete the installation, wiring, and setup of the meter for most applications.

Instructions are provided for changing the transmitter power supply to output 5 or 10 VDC instead of 24 VDC. See *Figure 5. Transmitter Supply Voltage Selection* on page 30.

Unpacking

Remove the meter from box. Inspect the packaging and contents for damage. Report damages, if any, to the carrier.

If any part is missing or the meter malfunctions, please contact your supplier or the factory for assistance.

Panel Mounting Instructions

- Prepare a standard 1/8 DIN panel cutout - 3.622" x 1.772" (92 mm x 45 mm). Refer to *Figure 1. 1/8 DIN Panel Cutout Dimensions* below for more details.
- Clearance: allow at least 6.0" (152 mm) behind the panel for wiring.
- Panel thickness: 0.04" - 0.25" (1.0 mm - 6.4 mm).
Recommended minimum panel thickness to maintain Type 4X rating: 0.06" (1.5 mm) steel panel, 0.16" (4.1 mm) plastic panel.
- Remove the two mounting brackets provided with the meter (back-off the two screws so that there is 1/4" (6.4 mm) or less through the bracket. Slide the bracket toward the front of the case and remove).
- Insert meter into the panel cutout.
- Install mounting brackets and tighten the screws against the panel. To achieve a proper seal, tighten the mounting bracket screws evenly until meter is snug to the panel along its short side. **DO NOT OVER TIGHTEN**, as the rear of the panel may be damaged.

Installation and Unpacking


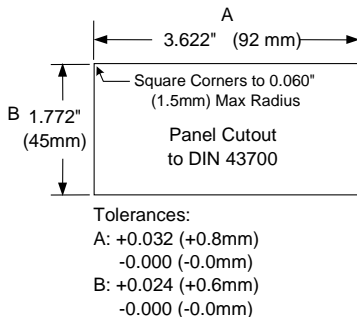


Figure 1. 1/8 DIN Panel Cutout Dimensions

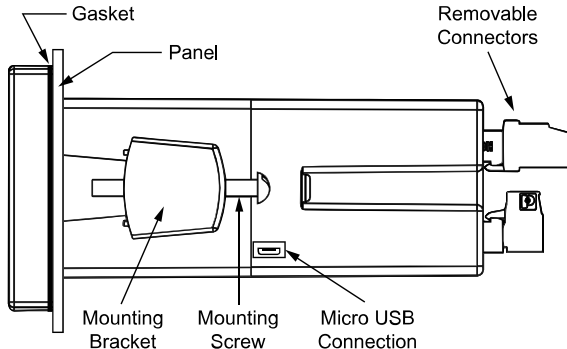

DO NOT apply AC or DC power to the meter when using the USB connection.

Figure 2. Panel Mounting Details

Installation and Unpacking

Mounting Dimensions

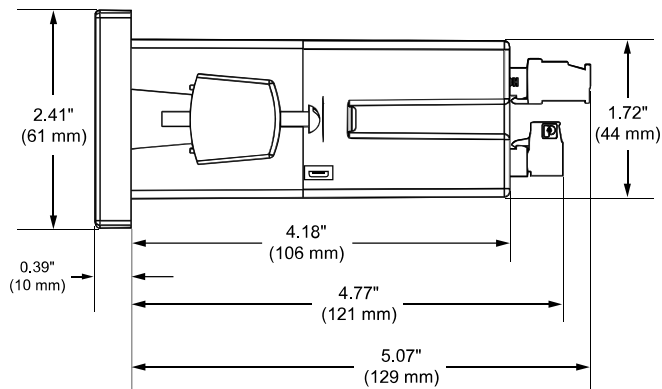


Figure 3. Meter Dimensions - Side View

Installation and Unpacking

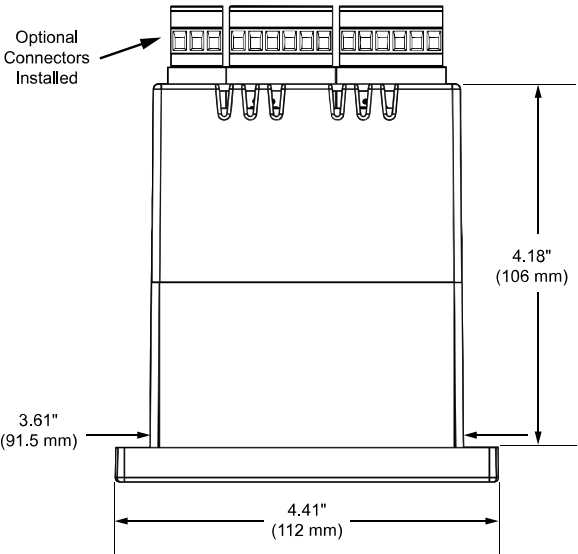


Figure 4. Meter Dimensions - Top View

Installation and Unpacking

Installation Overview

We recommend the following sequence for getting the meter into service:

1. **DO NOT** apply AC or DC power to the meter.
2. Connect the meter to the PC with the USB cable provided. **DO NOT** use a different USB cable.
3. If Configuration Software is already installed in your computer, then the program will launch automatically in most systems. If the program does not start automatically, double-click on the Configuration Software icon.
4. If Configuration Software is not installed, follow the instructions provided below.
5. Use Configuration Software to configure the meter for your application.
6. Disconnect the USB cable from the meter.
7. Apply power and signal and check operation of the meter.
8. Install the meter and put into service.
9. Make any programming adjustments using the front panel buttons.

Programming Software

The easiest and quickest way to program your IDE30 meter is to use the free programming software. This software is loaded into the meter and connects and installs directly to your PC with the USB cable provided. **DO NOT** use a different USB cable. We recommend that the first thing you do after taking the meter out of the box is connect the IDE30 to your PC with the provided USB cable. **DO NOT** apply AC or DC power to the meter while your PC is connected to the meter as it will disrupt the USB connection. It is not necessary to apply an input signal.

Installation and Unpacking

The programming software is intuitive, and most customers can get their meter programmed as they like without even looking in the manual.

Configuration Software Installation

1. Connect one end of the provided USB cable to the meter and the other end to the computer. The computer will automatically install the driver software it needs to talk to the meter. Follow the on-screen instructions and allow sufficient time for the process to complete. This can take a few minutes. If the process is interrupted, then it could leave the system in an unstable condition.

 


WARNINGS


Only one meter may be connected at a time. Attaching multiple meters will cause a conflict with the meter software.

DO NOT apply AC or DC power to the meter when using the USB connection.

2. Once the driver is installed, an AutoPlay dialog should appear for the drive "MAINSTAL." Click "Open folder to view files."




 If the computer does not display an AutoPlay dialog for the drive "MAINSTAL," you should open My Computer and double-click on the drive labeled "MAINSTAL."




Installation and Unpacking

3. Double-click on the file named “MAStart.” The program will open a few windows and install two programs on your computer. Simply follow the on-screen instructions until you see one of the dialogs below. If you receive a “User Account Control” warning, click “Yes.”

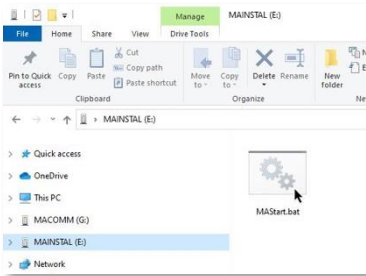

4. If there is an update available, click the “Update” button to install the new version. Otherwise, click “Configure” to begin programming your meter.

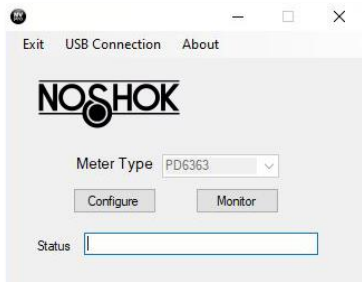

Installation and Unpacking

Note: If you decide to update your programming software, once the installation has completed, you will be asked if you want to update the setup files located on the meter itself. This way, you will always have the most current version on the meter for future installs.



WARNING

DO NOT unplug the meter while the new installation files are being written to it. The meter will display **⚠ ⚠ ⚠** during the process and you will receive an on-screen notification once the process is complete.

Installation and Unpacking

Transmitter Supply Voltage Selection (P+, P-)

All meters, including models equipped with the 12-24 VDC power option, are shipped from the factory configured to provide 24 VDC power for the transmitter or sensor.

If the transmitter requires 5 or 10 VDC excitation, the internal jumper J4 must be configured accordingly.

To access the voltage selection jumper:

1. Remove all the wiring connectors.
2. Unscrew the back cover.
3. Slide out the back cover by about 1 inch.
4. Configure the J4 jumper, located behind the input signal connector, for the desired excitation voltage as shown.

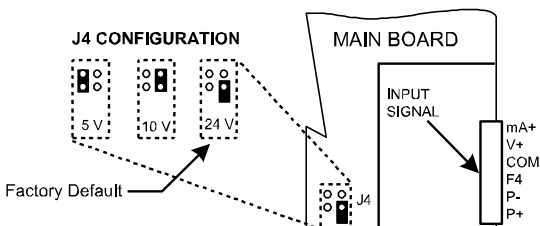


Figure 5. Transmitter Supply Voltage Selection

Connections

Connections

All connections are made to removable screw terminal connectors located at the rear of the meter.



CAUTION

Use copper wire with 60°C or 60/75°C insulation for all line voltage connections. Observe all safety regulations. Electrical wiring should be performed in accordance with all applicable national, state, and local codes to prevent damage to the meter and ensure personnel safety.

Connections

Connectors Labeling

The connectors' label, affixed to the meter, shows the location of all connectors available with requested configuration.

Note: # on the following figures refers to the power option. (Example: IDE30-A-1-2-5)

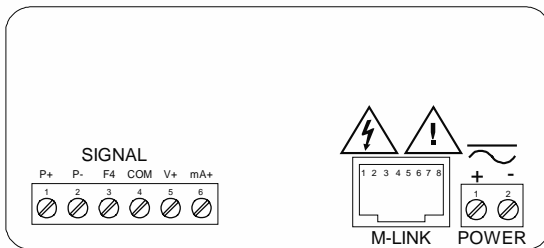


Figure 6. IDE30-A-#-2-0 Connectors Label

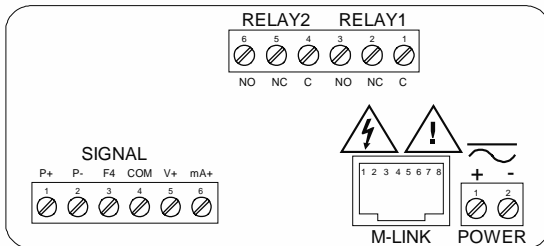


Figure 7. IDE30-A-#-2-1 Connectors Label

Connections

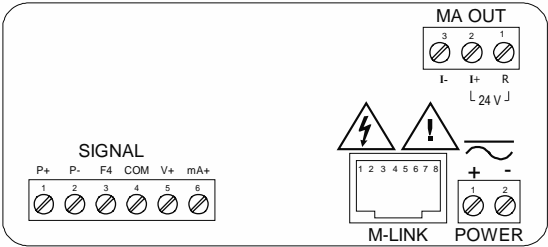


Figure 8. IDE30-A-#-2-2 Connectors Label

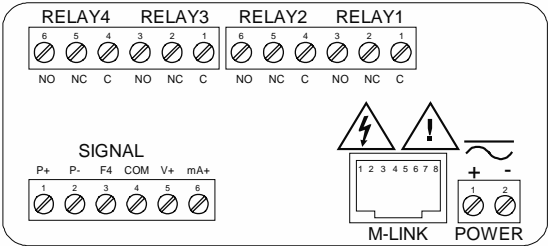


Figure 9. IDE30-A-#-2-3 Connectors Label

Connections

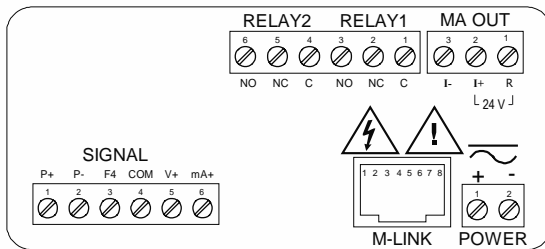


Figure 10. IDE30-A-#-2-4 Connectors Label

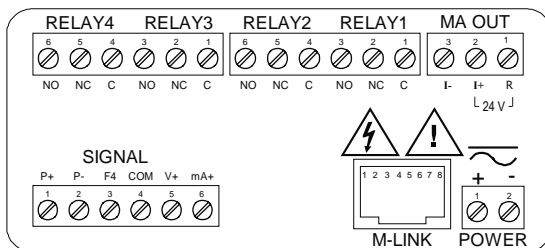


Figure 11. IDE30-A-#-2-5 Connectors Label




WARNING

DO NOT connect any equipment to the RJ45 M-LINK connector. Damage will occur to the equipment and the meter.

Connections

Power Connections

Power connections are made to a two-terminal connector labeled POWER. The meter will operate regardless of DC polarity connection. The + and - symbols are only a suggested wiring convention. There are separate models for low voltage and high voltage power. See *Ordering Information* on page 10 for details.

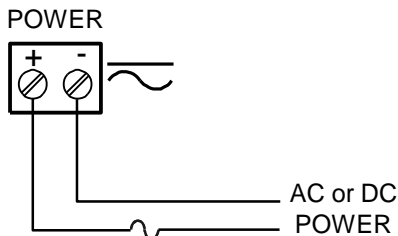

Required External Fuse:
5 A max, 250 V Slow Blow

Figure 12. Power Connections

Connections

Signal Connections

Signal connections are made to a six-terminal connector labeled SIGNAL. The COM (common) terminal is the return for the 4-20 mA and the ± 10 V input signals.

Current (mA) Connections

The following figures show examples of current connections. There are no switches or jumpers to set up for current inputs. Setup and programming is performed through the front panel buttons or Configuration Software.

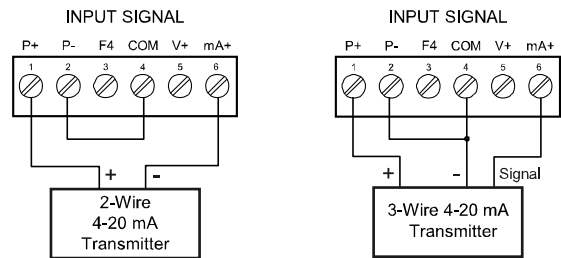


Figure 13. Transmitters Powered by Internal Supply

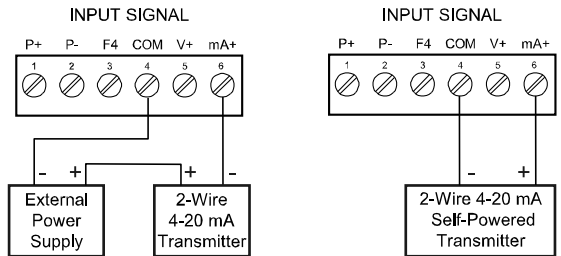


Figure 14. Transmitter Powered by External Supply or Self-Powered

Connections

The current input is protected against current overload by an internal resettable fuse. The display may or may not show a fault condition depending on the nature of the overload. The fuse limits the current to a safe level when it detects a fault condition, and automatically resets itself when the fault condition is removed.

Voltage (V) Connections

The following figures show examples of voltage connections. There are no switches or jumpers to set up for voltage inputs. Setup and programming is performed through the front panel buttons or Configuration Software.

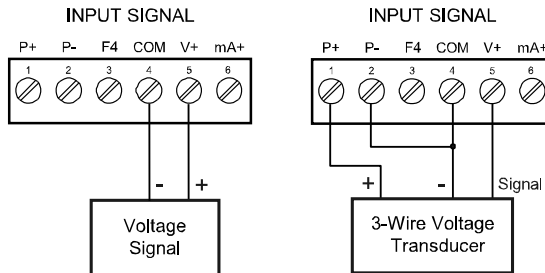


Figure 15. Voltage Input Connections

The meter is capable of accepting any voltage from -10 VDC to +10 VDC.

Connections

Relay Connections

Relay connections are made to two six-terminal connectors labeled RELAY1 – RELAY4. Each relay's C terminal is common only to the normally open (NO) and normally closed (NC) contacts of the corresponding relay. The relays' C terminals should not be confused with the COM (common) terminal of the INPUT SIGNAL connector.

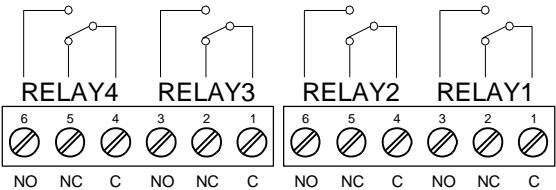


Figure 16. Relay Connections

Connections

Switching Inductive Loads

The use of snubbers to suppress electrical noise is strongly recommended when switching inductive loads to prevent disrupting the microprocessor's operation. The snubbers also prolong the life of the relay contacts. Suppression can be obtained with resistor-capacitor (RC) networks assembled by the user or purchased as complete assemblies. Refer to the following circuits for RC network assembly and installation:

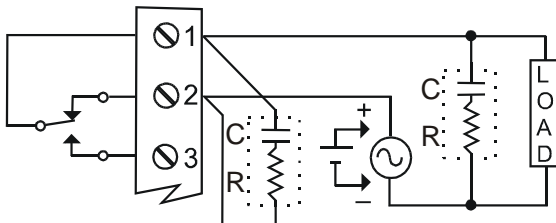


Figure 17. AC and DC Loads Protection

Choose R and C as follows:


R: 0.5 to 1 Ω for each volt across the contacts

C: 0.5 to 1 μF for each amp through closed contacts

Notes:

1. Use capacitors rated for 250 VAC.
2. RC networks may affect load release time of solenoid loads. Check to confirm proper operation.
3. Install the RC network at the meter's relay screw terminals. An RC network may also be installed across the load. Experiment for best results.

Connections

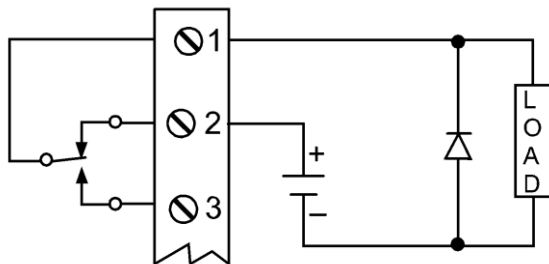

Use a diode with a reverse breakdown voltage two to three times the circuit voltage and forward current at least as large as the load current.

Figure 18. Low Voltage DC Loads Protection

F4 Digital Input Connections

A digital input, F4, is standard on the meter. This digital input should be connected with a normally open contact across F4 and COM, or with an active low signal applied to F4. It can be used for remote operation of front-panel buttons, to acknowledge/reset relays, or to reset max/min values. See Function Keys & F4 Digital Input Available Settings on page 105 for a complete list of capabilities.

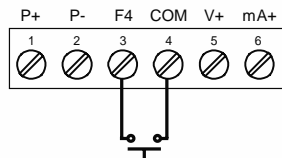


Figure 19. F4 Digital Input Connections

Connections

4-20 mA Output Connections

Connections for the 4-20 mA transmitter output are made to the connector terminals labeled mA OUT. The 4-20 mA output may be powered internally or from an external power supply.

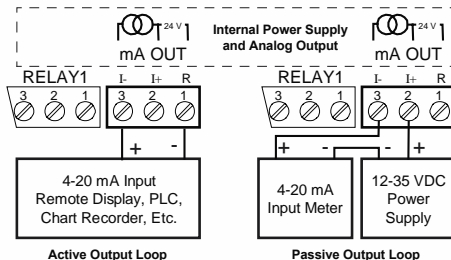


Figure 20. 4-20 mA Output Connections

Analog Output Power Supply

The internal 24 VDC power supply powering the analog output may be used to power other devices, if the analog output is not used. The I+ terminal is the +24 V and the R terminal is the return.

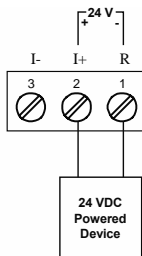


Figure 21. Analog Output Power Supply Powering Other Devices

Setup and Programming

Setup and Programming

There is **no need to recalibrate** the meter when first received from the factory.

The meter is **factory calibrated** prior to shipment for milliamps and volts with calibration equipment that is certified to NIST standards.

Overview

There are no jumpers to set for the meter input selection.





Setup and programming is done using Configuration Software or through the front panel buttons.

After power and input signal connections have been completed and verified, apply power to the meter.

Setup and Programming

Front Panel Buttons and Status LED Indicators



Button Symbol	Description
	Menu
	Right arrow/F1
	Up arrow/F2
	Enter/F3

Setup and Programming

LED	State	Indication
1-4	Steady	Alarm condition based on set and reset points, independent of relay status in certain configurations. (Available on all meter configurations, including those without relays installed)
1-4 & M	Flashing	Relay in manual control mode
T	Flashing	Meter in Tare mode
M	Flashing	Analog output in manual control mode

- Press the Menu button to enter or exit the Programming Mode at any time.
- Press the Right arrow button to move to the next digit during digit or decimal point programming.
- Press or hold the Up arrow button to scroll through the menus, decimal point, or to increment the value of a digit.
- Press the Enter button to access a menu or to accept a setting.
- Press and hold the Menu button for three seconds to access the advanced features of the meter.

Setup and Programming

Display Functions & Messages

The meter displays various functions and messages during setup, programming, and operation. The following table shows the main menu functions and messages in the order they appear in the menu.

Display Functions & Messages		
Display	Parameter	Action/Setting Description
SEtUP	Setup	Enter <i>Setup</i> menu
INPut	Input	Enter <i>Input</i> selection menu
mA	4-20 mA	Set meter for 4-20 mA input
VOLt	0-10 VDC	Set meter for ± 10 VDC input
d-SERL	Dual-scale	Press Enter to select dual-scale display for some level applications (Select Yes or No)
un tS	Units	Select the display units/tags
dEc Pt	Decimal point	Set decimal point
PV 1	PV1	PV1 decimal point (Level)
PV 2	PV2	PV2 decimal point (Level)
ProG	Program	Enter the <i>Program</i> menu
SERLE	Scale	Enter the <i>Scale</i> menu
SERL 1	Scale 1	Enter the <i>Scale</i> menu for PV1
SERL 2	Scale 2	Enter the <i>Scale</i> menu for PV2
CRl	Calibrate	Enter the <i>Calibration</i> menu
INP 1	Input 1	Calibrate input 1 signal or program input 1 value
d iS 1	Display 1	Program display 1 value
INP 2	Input 2	Calibrate input 2 signal or program input 2 value (up to 32 points)
d iS 2	Display 2	Program display 2 value (up to 32 points)
Error	Error	Error, calibration not successful, check signal or programmed value

Setup and Programming

Display Functions & Messages

Display	Parameter	Action/Setting Description
dSPLRy	<i>Display</i>	Enter the <i>Display</i> menu
L nE 1	<i>Display Line 1</i>	Press Enter to assign the Main display parameter (default: PV)
L nE 2	<i>Display Line 2</i>	Press Enter to assign the small display parameter (default: engineering units)
d- IntY	<i>Display intensity</i>	Set display intensity level from 1 to 8
rELRY	<i>Relay</i>	Enter the <i>Relay</i> menu
rLY 1	<i>Relay 1</i>	Relay 1 setup
Rct 1	<i>Action 1</i>	Set relay 1 action
Ruto	<i>Automatic</i>	Set relay for automatic reset
R-nRn	<i>Auto-manual</i>	Set relay for automatic & manual reset any time
LRtCH	<i>Latching</i>	Set relay for latching operation
Lt-CLr	<i>Latching-cleared</i>	Set relay for latching operation with manual reset only after alarm condition has cleared
RLtErn	<i>Alternate</i>	Set relay for pump alternation control
SRnPL	<i>Sampling</i>	Set relay for sampling operation
OFF	<i>Off</i>	Disable relay and front panel status LED
SEt 1	<i>Set 1</i>	Program set point 1
rSEt 1	<i>Reset 1</i>	Program reset point 1
rLY 2	<i>Relay 2</i>	Relays 2-4 setup
FR LSF	<i>Fail-safe</i>	Enter <i>Fail-safe</i> menu
FLS 1	<i>Fail-safe 1</i>	Set relay 1 fail-safe operation
on	<i>On</i>	Enable fail-safe operation
oFF	<i>Off</i>	Disable fail-safe operation
FLS 2	<i>Fail-safe 2</i>	Set relays 2-4 fail-safe operation

Setup and Programming

Display Functions & Messages

Display	Parameter	Action/Setting Description
dELAY	<i>Delay</i>	Enter relay <i>Time Delay</i> menu
dLY 1	<i>Delay 1</i>	Enter relay 1 time delay setup
On 1	<i>On 1</i>	Set relay 1 On time delay
OFF 1	<i>Off 1</i>	Set relay 1 Off time delay
dLY 2	<i>Delay 2</i>	Enter relays 2-4 time delay setup
brERK	<i>Loop break</i>	Set relay condition if loop break detected
Ignore	<i>Ignore</i>	Ignore loop break condition (Processed as a low signal condition)
On	<i>On</i>	Relay goes to alarm condition when loop break is detected
OFF	<i>Off</i>	Relay goes to non-alarm condition when loop break is detected
Rout	<i>Analog output</i>	Enter the <i>Analog output</i> scaling menu
d IS 1	<i>Display 1</i>	Program display 1 value
Out 1	<i>Output 1</i>	Program output 1 value (e.g. 4.000 mA)
d IS 2	<i>Display 2</i>	Program display 2 value
Out 2	<i>Output 2</i>	Program output 2 value (e.g. 20.000 mA)
rESEt	<i>Reset</i>	Press Enter to access the <i>Reset</i> menu
rSt H i	<i>Reset high</i>	Press Enter to reset max display
rSt Lo	<i>Reset low</i>	Press Enter to reset min display
rSt HL	<i>Reset high & low</i>	Press Enter to reset max & min displays
rSt tr	<i>Reset tare</i>	Reset tare
ContRL	<i>Control</i>	Enter <i>Manual Control</i> menu
Ruto	<i>Automatic</i>	Press Enter to set meter for automatic operation
man	<i>Manual</i>	Press Enter to manually control relays or analog output operation

Setup and Programming


<i>PR55</i>	<i>Password</i>	Enter the <i>Password</i> menu
<i>PR55 1</i>	<i>Password 1</i>	Set or enter Password 1
<i>PR55 2</i>	<i>Password 2</i>	Set or enter Password 2
<i>PR55 3</i>	<i>Password 3</i>	Set or enter Password 3
<i>unLoc</i>	<i>Unlocked</i>	Program password to lock meter
<i>Locd</i>	<i>Locked</i>	Enter password to unlock meter
<i>999999</i> <i>-99999</i>	<i>Flashing</i>	Over/under range condition

Setup and Programming

Main Menu

The main menu consists of the most commonly used functions: *Setup*, *Reset*, *Control*, and *Password*.

- Press Menu button to enter Programming Mode then press the Up arrow button to scroll main menu.
- Press Menu, at any time, to exit and return to Run Mode. Changes made to settings prior to pressing Enter are not saved.
- Changes to the settings are saved to memory only after pressing Enter/F3.
- The display moves to the next menu every time a setting is accepted by pressing Enter/F3.

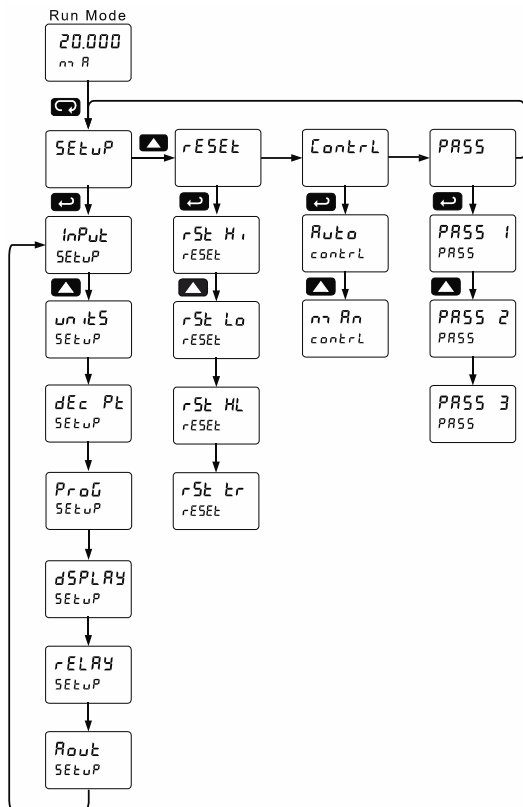


Setup and Programming

Setting Numeric Values

The numeric values are set using the Right and Up arrow buttons. Press Right arrow to select next digit and Up arrow to increment digit value. The digit being changed is displayed brighter than the rest. Press and hold Up to auto-increment the display value. If negative numbers are allowed, the first digit position will include a negative symbol (-) after the 9.

 Press the Enter button, at any time, to accept a setting or Menu button to exit without saving changes.




Setup and Programming

Setting Up the Meter (SEtUP)

The *Setup* menu is used to select:

1. Input signal the meter will accept
2. Dual-scale feature for some level applications
3. Select the display units/tags
4. Decimal point position
5. Programming Menu
6. Display parameter and intensity
7. Relay operation
8. 4-20 mA analog output scaling

Press the Enter button to access any menu or press Up arrow button to scroll through choices. Press the Menu button to exit at any time.

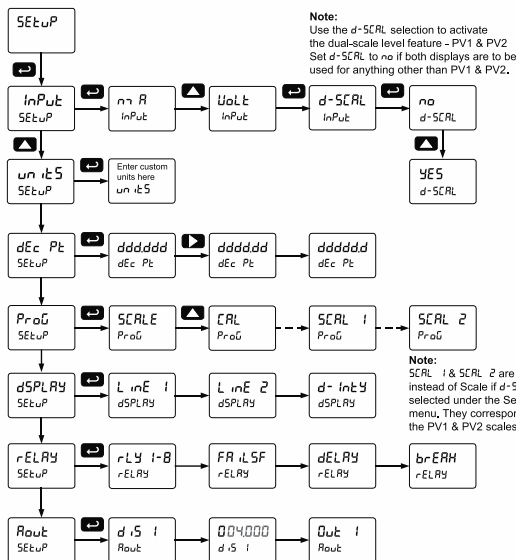

Setup and Programming

Setting the Input Signal (Input)


Enter the *Input* menu to set up the meter to display current (*mA*) or voltage (*Volt*) inputs.

The current input is capable of accepting any signal from 0 to 20 mA. Select current input to accept 0-20 mA or 4-20 mA signals.

The voltage input is capable of accepting any signal from -10 to +10 VDC. Select voltage input to accept 0-5, 1-5, 0-10, or ± 10 VDC signals.

After selecting *mA* or *Volt* input, *d-SLR* is displayed; press Enter to select "Yes" or "No".

Selecting "Yes" enables the dual-scale feature, which allows for the Scale (*SCALE*) and Units (*units*) menus to be used to scale the same input in two different scales for PV1 & PV2.

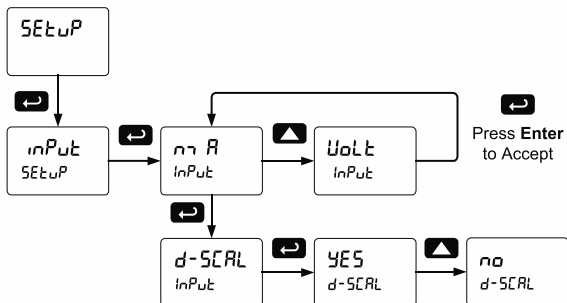

Set *d-SLR* to no if only one scale is needed for the input.

Setup and Programming

Setting the Display Units or Custom Tags (ህክ ሳይ)

Enter the display unit or custom tag that will be displayed if **ህክ ሳይ** is selected as the line 2 parameter. See the *Setting the Display Parameter & Intensity (ሳይፒላሪ)* flow chart on page 61 to access the display menu to show the unit or tag on display line 2. The engineering units or custom legends can be set using the following 7-segment character set:

Display	Character
0	0
1	1
2	2
3	3
4	4
5	5
6	6
7	7
8	8
9	9
A	A
b	b
C	C
c	c
d	d
E	E
F	F

Display	Character
G	G
g	g
H	H
h	h
I	I
i	i
J	J
K	K
L	L
m	m
n	n
O	O
o	o
P	P
q	q
r	r
S	S

Display	Character
t	t
u	u
v	V
w	w
X	X
Y	Y
Z	Z
-	-
/	/
[]
]	[
=	=
°	Degree(<)
	Space

Notes:

1. Degree symbol represented by (<) if programming with Configuration Software.
2. The letters “m” and “w” use two 7-segment LEDs each; when selected the characters to the right are shifted one position.
3. Press and hold up arrow to auto-scroll the characters in the display.


Setup and Programming

Setting the Decimal Point (dEc Pt)

The decimal point may be set with up to five decimal places or with no decimal point at all. The decimal point selection should be made prior to scaling, calibrating or programming the meter.

Pressing the Right arrow moves the decimal point one place to the right until no decimal point is displayed, and then it moves to the leftmost position. Pressing the Up arrow moves the decimal point one place to the left.

If the dual-scale level feature is selected, the decimal point selections for PV1 & PV2 are enabled.

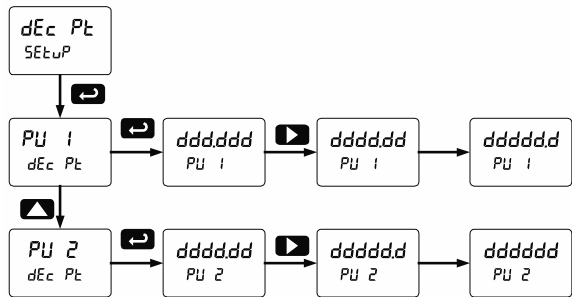

Setup and Programming

Programming the Meter (Prog)

The meter may either be scaled (SCALE) without applying an input or calibrated (CAL) by applying an input. The meter comes factory calibrated to NIST standards, so for initial setup, it is recommended to use the (SCALE) function.

The Program menu contains the Scale (SCALE) and the Calibrate (CAL) menus.

Process inputs may be scaled or calibrated to any display within the range of the meter.

The IDE30 is a single input meter with dual-scale capability.

 
If the dual-scale level feature is selected in the *Setup* menu, the *Scale 1* and *Scale 2* menus are enabled for PV1 & PV2 respectively.

The process input may be calibrated or scaled to any display value within the range of the meter.


*Note: The **Scale** and **Calibrate** functions are exclusive of each other. The meter uses the last function programmed. Only one of these methods can be employed at a time. The Scale and Calibrate functions can use up to 32 points (default is 2). The number of points should be set in the Advanced menu prior to scaling and calibration of the meter. See Multi-Point Linearization (LINEAR) on page 100 for details.*

Setup and Programming

Program Menu for Single Scale Process



 Program Menu for Dual-Scale Level Applications



Additional parameters, not needed for most applications, are programmed in the *Advanced Features* menu. See *Advanced Features Menu* on page 93.

Multi-Point Calibration & Scaling


The meter is set up at the factory for 2-point linear calibration. The number of points for multi-point calibration/scaling is set up in the *Advanced Features* menu. Up to 32 linearization points may be selected for PV1 and up to 8 linearization points may be selected for PV2. See *Multi-Point Linearization (L_{INERR})* on page 100 for details.

Setup and Programming

Scaling the Meter (SCALE)

The process input (4-20 mA, ± 10 VDC) can be scaled to display the process variable in engineering units.

A signal source is not needed to scale the meter; simply program the inputs and corresponding display values.

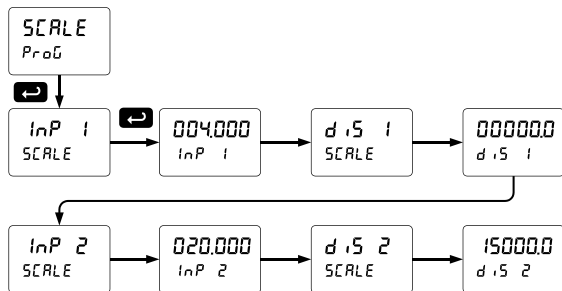


Dual-Scale for Level Applications

The analog input can be displayed in two different scales, by enabling the dual-scale feature (**d-SCALE**) in the *Setup - Input* menu. See *Setting the Input Signal (InP_ut)* on page 52.


To enable the dual-scale feature for some level applications you must select **d-SCALE** in the Input selection menu.

Setup and Programming

Scaling the Input for PV1 (SCAL 1)

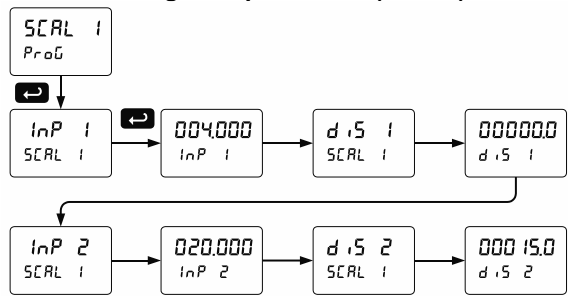

Scaling the Input for PV2 (SCAL 2)

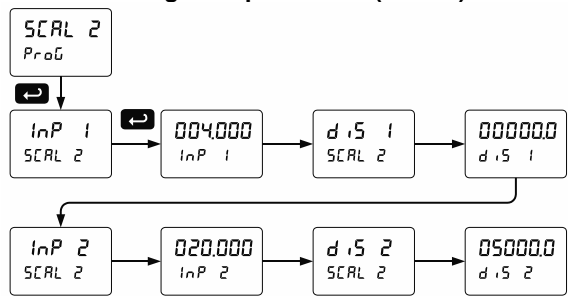

Setup and Programming

Error Message (Error)

An error message indicates that the calibration or scaling process was not successful.

After the error message is displayed, the meter reverts to the input prior to the failure during calibration or scaling and to input 1 during internal calibration, allowing the appropriate input signal to be applied or programmed.

The error message might be caused by any of the following conditions:

1. Input signal is not connected to the proper terminals or it is connected backwards*.
2. Wrong signal selection in *Setup* menu*.
3. Minimum input span requirements not maintained.
4. Input 1 signal inadvertently applied to calibrate input 2*.

**Not relevant when scaling the meter.*

For instructions on how to program numeric values
see *Setting Numeric Values*, page 50.

Minimum Input Span

The minimum input span is the minimum difference between input 1 and input 2 signals required to complete the calibration or scaling of the meter.

Input Range	Input 1 & Input 2 Span
4-20 mA	0.15 mA
±10 VDC	0.10 VDC


Setup and Programming

Calibrating the Meter with External Source (CRL)

Note: To scale the meter without a signal source refer to Scaling the Meter (5CRL E) on page 57.

The meter can be calibrated to display the process variable in engineering units by applying the appropriate input signal and following the calibration procedure.

The use of a calibrated signal source is strongly recommended to calibrate the meter.

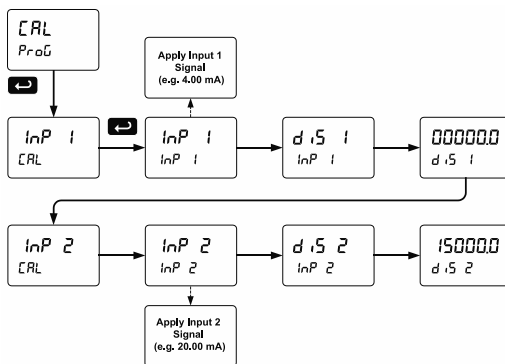

Note: Inputs for the above example are: Input 1: 4.00 mA; Display 1: 0.0 Gallons, Input 2: 20.00 mA; Display 2: 15000.0 Gallons

Warm up the meter for at least 15 minutes before performing calibration to ensure specified accuracy.

Setup and Programming

Setting the Display Parameter & Intensity (dSPRAY)

The main display (LINE 1) can be programmed to display:

1. Process value 1 (PV1)
2. Process value 2 (PV2)*
3. Percent of PV1 (PCT)*
4. Relay set points
5. Max & min values
6. Display reading and units
7. Display gross
8. Toggle net & gross

The secondary display (LINE 2) can be programmed to display:

1. Unit
2. Process value 1 (PV1)
3. Process value 2 (PV2)*
4. Percent of PV1 (PCT)*
5. Relay set points
6. Max & min values
7. Engineering units or custom legends
8. Off (no display)
9. Toggle reading and units
10. Display gross
11. Toggle net/gross

**These menu items will only appear if Dual-Scale feature is turned on.*

Setup and Programming

After setting up the input and display, press the Menu button to exit programming and skip the rest of the setup menu.

Display Intensity (d- lntY)

The meter has eight display intensity levels to give the best performance under various lighting conditions. Select intensity 8 for outdoor applications. The default intensity is 6.


Display Toggling Between Reading & Units with Tag

The IDE30 can be programmed so that line 1 toggles between the reading and units and line 2 displays a tag. For instance, line 1 toggles between 9500 and Gal and line 2 displays Tank 1.



Setup and Programming

Display Parameter Menu

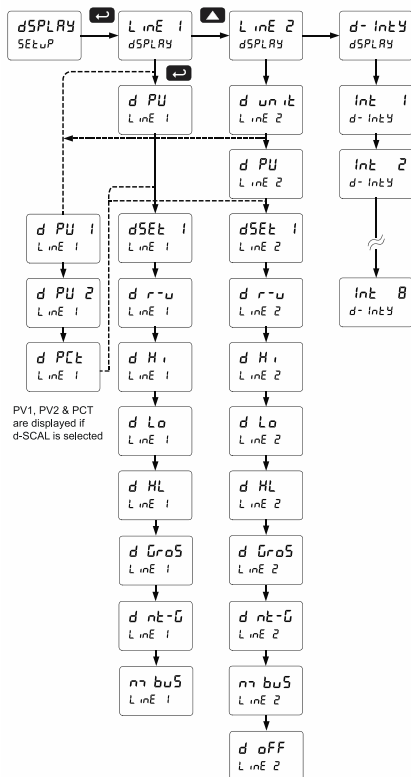


Setup and Programming

Dual-Scale Display Feature


The dual-scale feature is of particular value in level applications where a second scaled display can represent the measured input in a different form (i.e. gallons & height). Both displays are independently scaled and are based on the 4-20 mA input signal.



 
Gallons & mA



Gallons & Height

 

Gallons & Percent

 

Gallons & Head PSI

Setup and Programming

Setting the Relay Operation (rELAY)

This menu is used to set up the operation of the relays.




WARNING

During setup, the relays do not follow the input and they will remain in the state found prior to entering the Relay menu.

1. Relay action
 - a. Automatic reset only (non-latching)
 - b. Automatic + manual reset at any time (non-latching)
 - c. Latching (manual reset only)
 - d. Latching with Clear (manual reset only after alarm condition has cleared)
 - e. Pump alternation control (automatic reset only)
 - f. Sampling (the relay is activated for a user-specified time)
 - g. Off
2. Set point
3. Reset point
4. Fail-safe operation
 - a. On (enabled)
 - b. Off (disabled)
5. Time delay
 - a. On delay (0-999.9 seconds)
 - b. Off delay (0-999.9 seconds)
6. Relay action for loss (break) of 4-20 mA input (ignore, on, off)

Setup and Programming

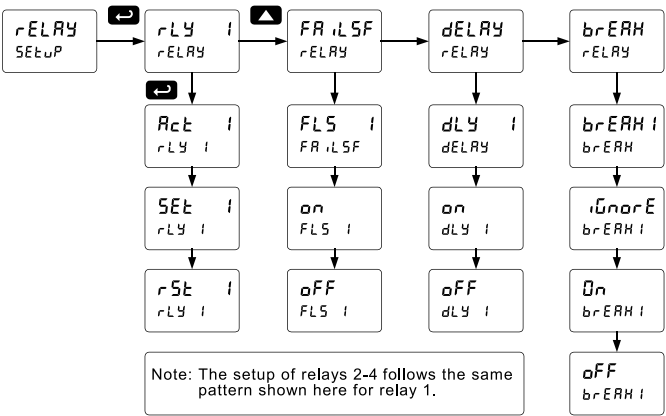


Setup and Programming

Setting the Relay Action

Operation of the relays is programmed in the *Action* menu. The relays may be set up for any of the following modes of operation:

1. Automatic reset (non-latching)
2. Automatic + manual reset at any time (non-latching)
3. Latching (manual reset only, at any time)
4. Latching with Clear (manual reset only after alarm condition has cleared)
5. Pump alternation control (automatic reset only)
6. Sampling (the relay is activated for a user-specified time)
7. Off (relay not active)

The graphic to the right shows relay 1 action setup; relay 2-4 are set up in a similar fashion.

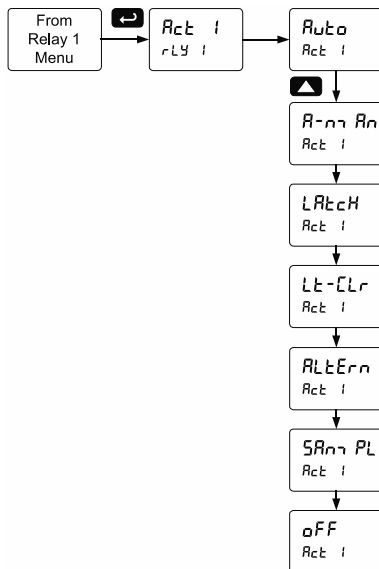


Setup and Programming

Programming Set and Reset Points

High alarm indication: program set point above reset point.

Low alarm indication: program set point below reset point.

The deadband is determined by the difference between set and reset points. Minimum deadband is one display count. If the set and reset points are programmed with the same value, the relay will reset one count below the set point.

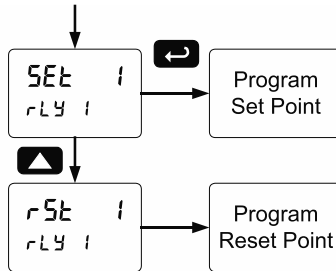

Note: Changes are not saved until the reset point has been accepted.

Setting Fail-Safe Operation

In fail-safe mode of operation, the relay coil is energized when the process variable is within safe limits and the relay coil is de-energized when the alarm condition exists. The fail-safe operation is set independently for each relay. Select **on** to enable or select **oFF** to disable fail-safe operation.

Setup and Programming

Programming Time Delay

The *On* and *Off* time delays may be programmed for each relay between 0 and 999.9 seconds. The relays will transfer only after the condition has been maintained for the corresponding time delay.

The *On* time delay is associated with the set point.

The *Off* time delay is associated with the reset point.


Relay Action for Loss of 4-20 mA Input (Loop Break)

A loop break condition is triggered when the 4-20 mA input signal drops below 0.005 mA. Each relay may be programmed to go to one of the following conditions when the meter detects the loss of the input signal (i.e. < 0.005 mA):

1. Turn *On* (Go to alarm condition)
2. Turn *Off* (Go to non-alarm condition)
3. Ignore (Processed as a low signal condition)

Setup and Programming

The following graph shows the loop break relay operation for a high alarm relay.

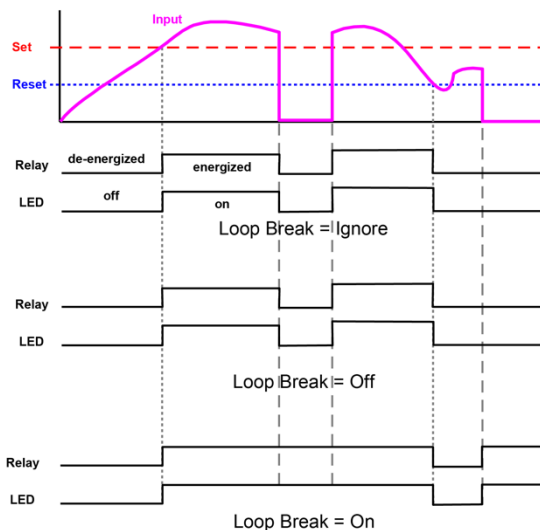


Setup and Programming

Relay and Alarm Operation Diagrams

The following graphs illustrate the operation of the relays, status LEDs, and ACK button.


High Alarm Operation (Set > Reset)

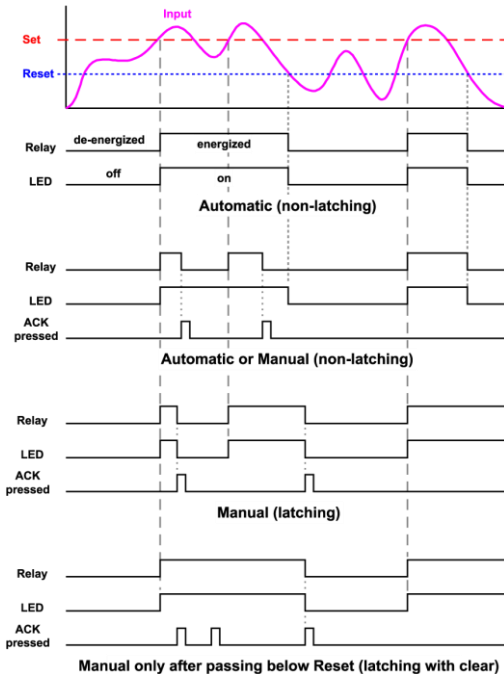

For Manual reset mode, ACK can be pressed anytime to turn "off" relay. To detect a new alarm condition, the signal must go below the set point, and then go above it.

Setup and Programming


Low Alarm Operation (Set < Reset)

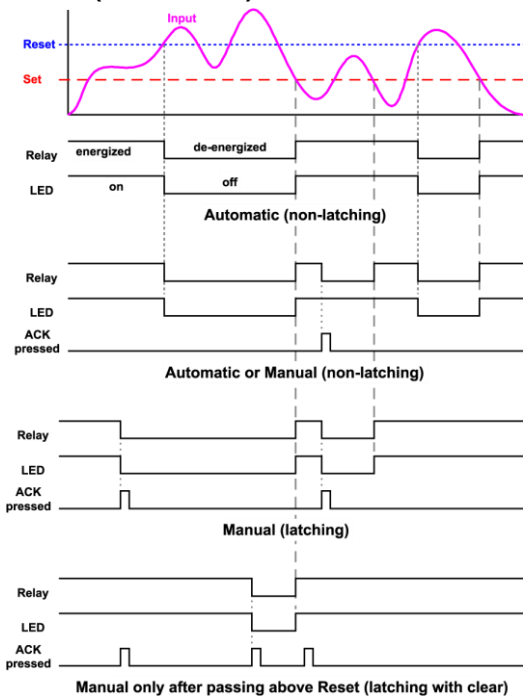

For Manual reset mode, ACK can be pressed anytime to turn "off" relay. For relay to turn back "on", signal must go above set point and then go below it.

Setup and Programming


High Alarm with Fail-Safe Operation (Set > Reset)

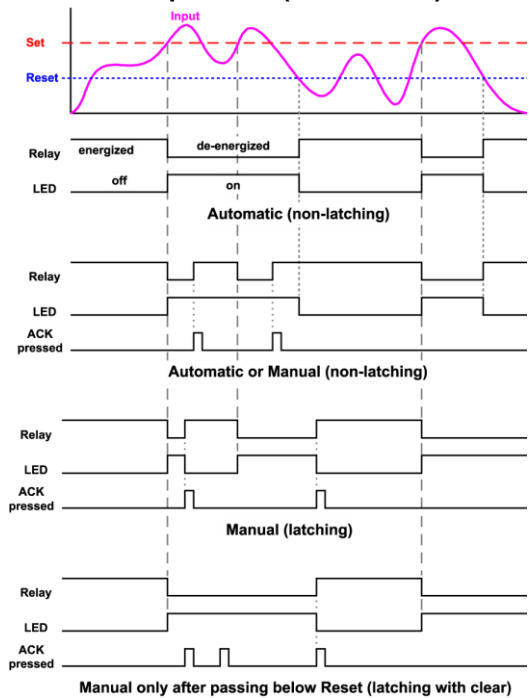

Note: Relay coil is energized in non-alarm condition. In case of power failure, relay will go to alarm state.

Setup and Programming

Low Alarm with Fail-Safe Operation (Set < Reset)

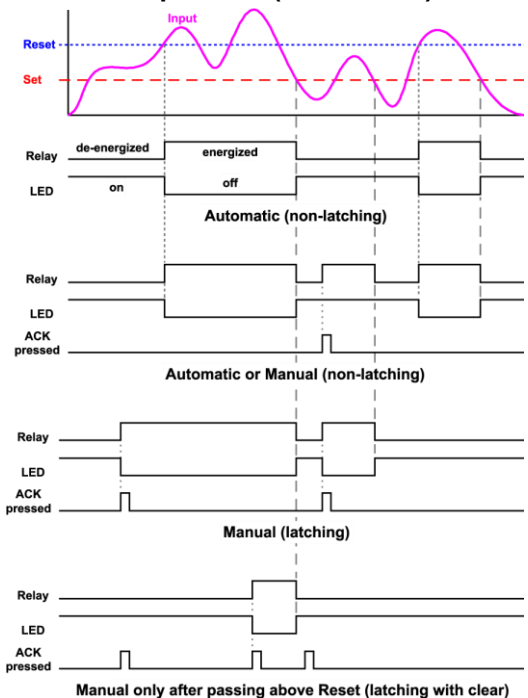


Note: Relay coil is energized in non-alarm condition. In case of power failure, relay will go to alarm state.


Setup and Programming

Time Delay Operation

The following graphs show the operation of the time delay function.

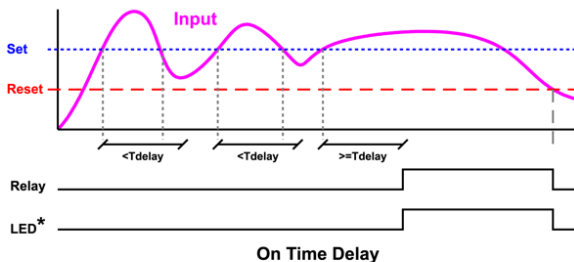

On Time Delay

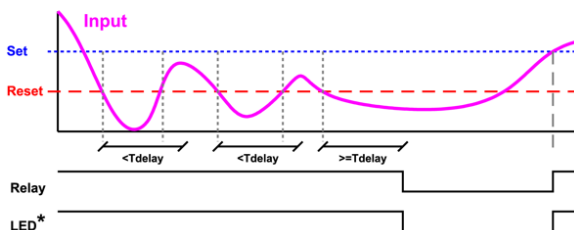


Off Time Delay

When the signal crosses the set point, the *On* time delay timer starts and the relay trips when the time delay has elapsed. If the signal drops below the set point (high alarm) before the time delay has elapsed, the *On* time delay timer resets and the relay does not change state. The same principle applies to the *Off* time delay.

Note: If "Automatic or Manual (R-nRn)" reset mode is selected, the LED follows the reset point and not the relay state when the relay is acknowledged.


Setup and Programming

Pump Alternation Control Operation

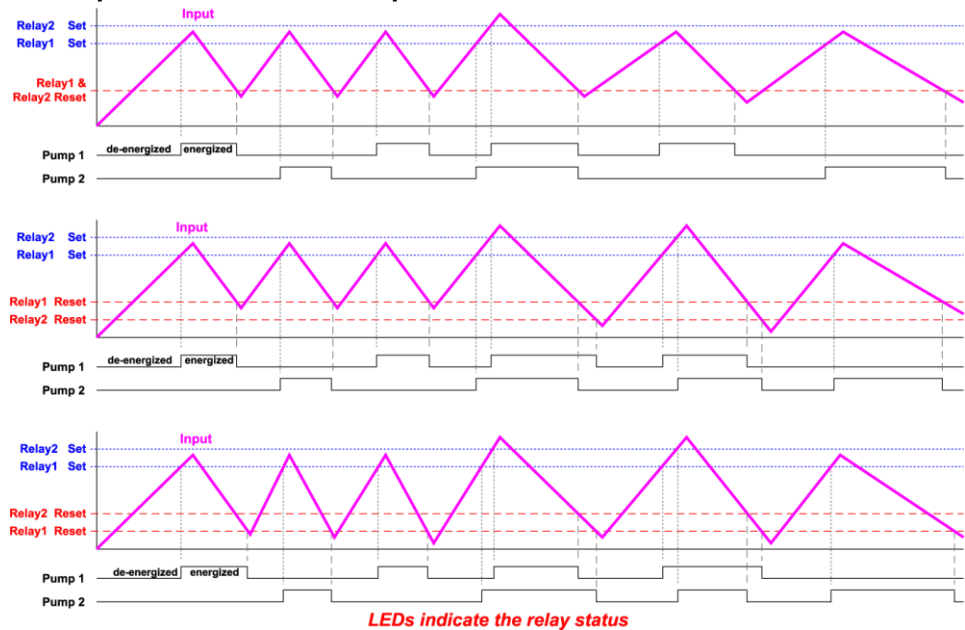

Setup and Programming

Relay Sampling Operation

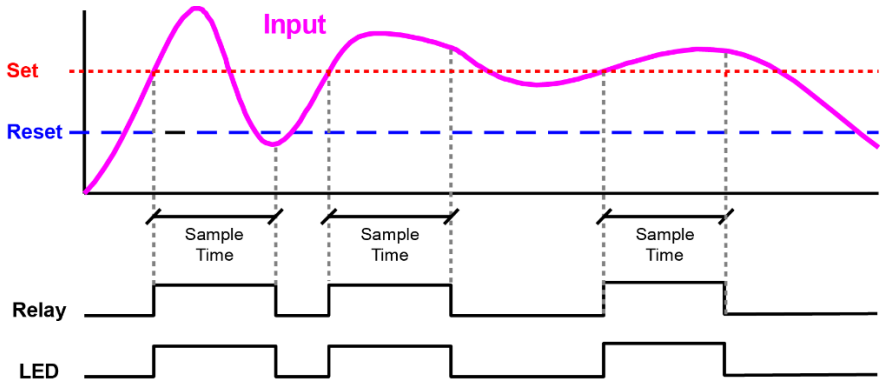

When the signal crosses the set point, the relay trips and the sample time starts. After the sample time has elapsed, the relay resets. The cycle repeats every time the set point is crossed, going up for high alarms and going down for low alarms.

The sample time can be programmed between 0.1 and 5999.9 seconds.

Setup and Programming

Relay Operation Details

Overview

The relay capabilities of the meter expand its usefulness beyond simple indication to provide users with alarm and control functions. These capabilities include front panel alarm status LEDs as well as either 2 or 4 optional internal relays. Typical applications include high and low temperature, level, pressure or flow alarms, control applications such as simple on/off pump control, and pump alternation control for up to 4 pumps. There are four basic ways the relays can be used:

1. High and Low Alarms with Latching or Non-Latching Relays
2. Simple On/Off Control with 100% Adjustable Deadband
3. Sampling (Based on Time)
4. Pump Alternation Control for up to 4 Pumps

Relays Auto Initialization

When power is applied to the meter, the front panel LEDs and alarm relays will reflect the state of the input to the meter. The following table indicates how the alarm LEDs and relays will react on power-up based on the set and reset points:

Alarm #	HI or LO Alarm	Set Point	Reset Point	Power-Up Reading	Relay & LED
1	HI	1000	500	499	Off
2	LO	700	900	499	On
3	LO	250	400	499	Off
4	HI	450	200	499	On

Setup and Programming

Fail-Safe Operation

The following table indicates how the relays behave based on the fail-safe selection for each relay:

Fail-Safe Selection	Non-Alarm State		Alarm State		Power Failure
	NO	NC	NO	NC	
Off	Open	Closed	Closed	Open	Relays go to non-alarm state
On	Closed	Open	Open	Closed	Relays go to alarm state

Note: NO = Normally Open, NC = Normally Closed. This refers to the condition of the relay contacts when the power to the meter is off.

Setup and Programming

Front Panel LEDs

The alarm status LEDs on the front panel are available on all meters, even those without relays installed, and provide status indication for the following:

LED	Status
1	Alarm 1
2	Alarm 2
3	Alarm 3
4	Alarm 4

The meter is supplied with four alarm points that include front panel LEDs to indicate alarm conditions. This standard feature is particularly useful for alarm applications that require visual-only indication. The LEDs are controlled by the set and reset points programmed by the user. When the display reaches a set point for a high or low alarm, the corresponding alarm LED will turn on. When the display returns to the reset point the LED will go off. The front panel LEDs respond differently for latching and non-latching relays.

For non-latching relays, the LED is always off during normal condition and always on during alarm condition, regardless of the state of the relay (e.g. Relay acknowledged after alarm condition).

For latching relays, the alarm LEDs reflect the status of the relays, regardless of the alarm condition. The following tables illustrate how the alarm LEDs function in relation to the relays and the acknowledge button (Default: F3 key assigned to ACK).

Setup and Programming

Latching and Non-Latching Relay Operation

The relays can be set up for latching (manual reset) or non-latching (automatic reset) operation.

Relay terminology for following tables	
Terminology	Relay Condition
On	Alarm (Tripped)
Off	Normal (Reset)
Ack	Acknowledged

The On and Off terminology does not refer to the status of the relay's coil, which depends on the fail-safe mode selected.



WARNING

In latching relay mode, if Fail-Safe is off, latched relays will reset (unlatch) when power is cycled.

Setup and Programming

Non-Latching Relay (ᐃᐅᐅᐅ)

In this application, the meter is set up for automatic reset (non-latching relay). Acknowledging the alarm while it is still present has no effect on either the LED or the relay. When the alarm finally goes away, the relay automatically resets and the LED also goes off.

Automatic reset only		
Condition	LED	Relay
Normal	Off	Off
Alarm	On	On
Ack (No effect)	On	On
Normal	Off	Off

Non-Latching Relay with Manual Reset (ᐃᐅᐅᐅᐅᐅ)

In this application, the meter is set up for automatic and manual reset at any time (non-latching relay). The LED and the relay automatically reset when the meter returns to the normal condition.

In addition, the relay can be manually reset while the alarm condition still exists, but the LED will stay on until the meter returns to the normal condition.

Automatic + manual reset at any time		
Condition	LED	Relay
Normal	Off	Off
Alarm	On	On
Normal	Off	Off
Next Alarm	On	On
Ack	On	Off
Normal	Off	Off

Setup and Programming

Latching Relay (LR-LH)

In this application, the meter is set up for manual reset at any time. Acknowledging the alarm even if the alarm condition is still present resets the relay and turns off the LED.

Manual reset any time		
Condition	LED	Relay
Normal	Off	Off
Alarm	On	On
Ack	Off	Off

Latching Relay with Clear (LR-CLR)

In this application, the meter is set up for manual reset only after the signal passes the reset point (alarm condition has cleared). Acknowledging the alarm while it is still present has no effect on either the LED or the relay. When the alarm is acknowledged after it returns to the normal state, the LED and the relay go off. Notice that the LED remains on, even after the meter returns to the normal condition. This is because, for latching relays, the alarm LED reflects the status of the relay, regardless of the alarm condition.


Manual reset only after alarm condition has cleared		
Condition	LED	Relay
Normal	Off	Off
Alarm	On	On
Ack (No effect)	On	On
Normal	On	On
Ack	Off	Off

Setup and Programming


Acknowledging Relays

There are two ways to acknowledge relays programmed for manual reset:

1. Via the programmable front panel function keys F1-F3 (Example: F3 assigned to ACK).

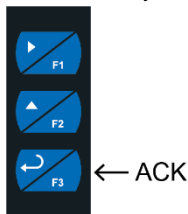

2. Remotely via a normally open push button wired to the F4 terminal at the rear of the instrument.

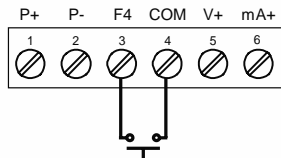

When the ACK button is closed, all relays programmed for manual reset are acknowledged.

Pump Alternation Control Applications (RLLEFn)

For pump control applications where two or more similar pumps are used to control the level of a tank or a well, it is desirable to have all the pumps operate alternately. This prevents excessive wear and overheating of one pump over the lack of use of the other pumps.

Up to 4 relays can be set up to alternate every time an on/off pump cycle is completed. The set points and reset points can be programmed, so that the first pump on is the first pump off.

Setup and Programming

Application #1: Pump Alternation Using Relays 1 & 2

1. Relays 1 and 2 are set up for pump alternation.
2. Relays 3 and 4 are set up for low and high alarm indication.

Set and Reset Point Programming			
Relay	Set Point	Reset Point	Function
1	30.000	10.000	Controls pump #1
2	35.000	5.000	Controls pump #2
3	4.000	9.000	Controls low alarm
4	40.000	29.000	Controls high alarm

Pump Alternation Operation

1. Pump #1 turns on when level reaches 30.000, when level drops below 10.000, pump #1 turns off.
2. The next time level reaches 30.000, pump #2 turns on, when level drops below 10.000, pump #2 turns off.
3. If the level doesn't reach 35.000, pump #1 and pump #2 will be operating alternately.
4. If pump #1 cannot keep the level below 35.000, pump #2 will turn on at 35.000, then as the level drops to 10.000, pump #1 turns off, pump #2 is still running and shuts off below 5.000.
5. Notice that with the set and reset points of pump #2 outside the range of pump #1, the first pump on is the first pump to go off. This is true for up to 8 alternating pumps, if setup accordingly.
6. Relay #3 will go into alarm if the level drops below 4.000 and relay #4 will go into alarm if the level exceeds 40.000.

Setup and Programming

Application #2: Pump Alternation Using Relays 3 & 4


1. Relays 1 and 2 are set up for low and high alarm indication.
2. Relays 3 and 4 are set up for pump alternation.

Set and Reset Point Programming			
Relay	Set Point	Reset Point	Function
1	495	750	Controls low alarm
2	7500	6900	Controls high alarm
3	7000	900	Controls backup pump
4	6000	1000	Controls main pump

Pump Alternation Visual Representation


The following graphics provide a visual representation of a typical pump alternation application with high and low alarm monitoring:

1. Relay #4 turns the main pump on at 6000 gallons and turns it off at 1000 gallons.

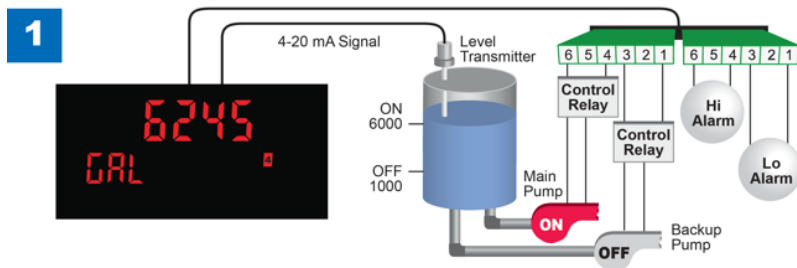


Setup and Programming

2. With the Pump Alternation feature activated, the next time the level reaches 6000 gallons, relay #3 transfers and starts the backup pump.

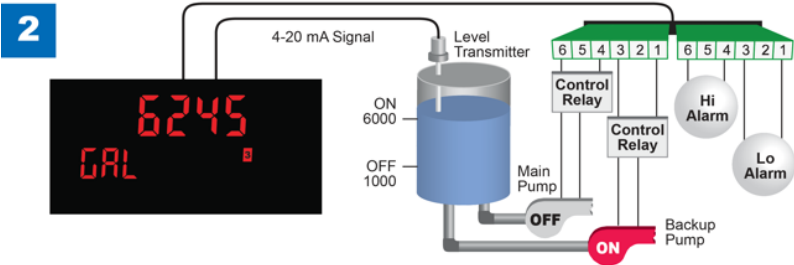


3. If the backup pump is not able to keep up, and the level reaches 7000 gallons, relay #4 transfers and starts the main pump as well.

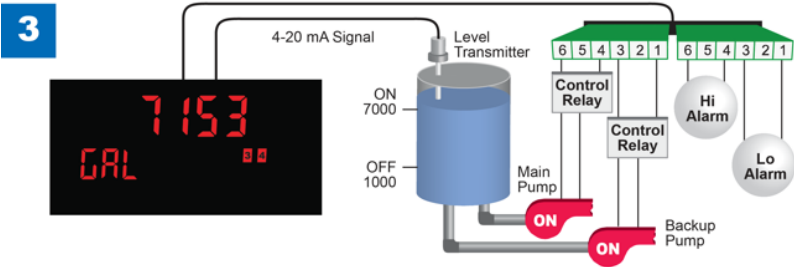


Setup and Programming

4. Relay #2 trips the High Level Alarm at 7500 gallons and resets at 6900 gallons.

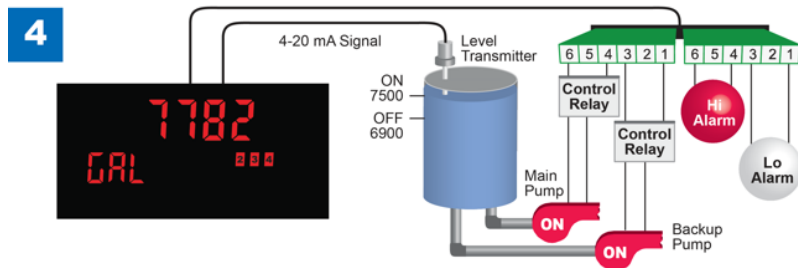

5. Relay #1 trips the Low Level Alarm at 495 gallons and resets at 750 gallons.

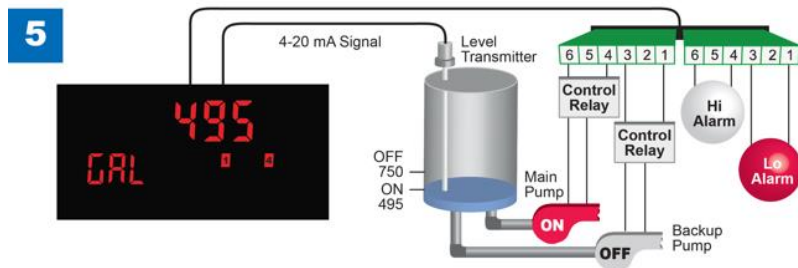

Setup and Programming


Scaling the 4-20 mA Analog Output (Rout)

The 4-20 mA analog output can be scaled to provide a 4-20 mA signal for any display range selected.

No equipment is needed to scale the analog output; simply program the display values to the corresponding mA output signal.

The *Analog Output* menu is used to program the 4-20 mA output based on display values.

For further details, see *Setting Numeric Values*, page 50,
Relay Action for Loss of 4-20 mA Input (Loop Break), page 69.

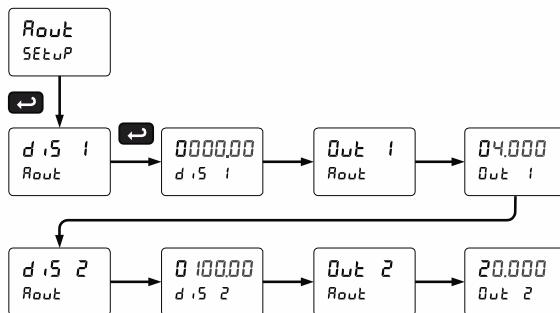


Reset Menu (rESEt)

The *Reset* menu is used to reset the maximum or minimum reading (peak or valley) reached by the process; both may be reset at the same time by selecting “reset high & low” (r5t HL). The tare value used to zero the display may be reset by selecting “reset tare” (r5t tr).

Setup and Programming

Manual Control Menu (Control)

The *Manual Control* menu is used to control the 4-20 mA analog output and the relays manually, ignoring the input. Each relay and analog output can be programmed independently for manual control. Selecting automatic control sets all relays and analog output for automatic operation.

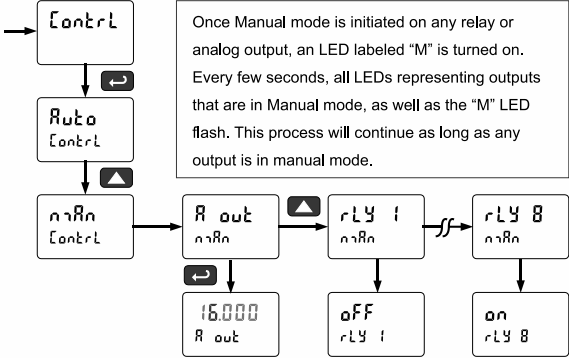

Setup and Programming

Setting Up the Password (PR55)

The *Password* menu is used for programming three levels of security to prevent unauthorized changes to the programmed parameter settings.

Pass 1: Allows use of function keys and F4 digital input


Pass 2: Allows use of function keys, F4 digital input, and editing set/reset points

Pass 3: Restricts all programming, function keys, and F4 digital input.

Protecting or Locking the Meter

Enter the *Password* menu and program a six-digit password.

For instructions on how to program numeric values see *Setting Numeric Values* on page 50.

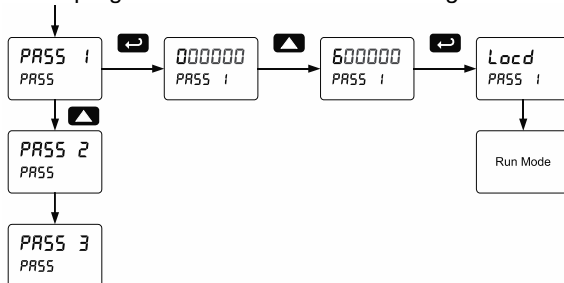


Making Changes to a Password Protected Meter

If the meter is password protected, the meter will display the message **Lock (Locked)** when the Menu button is pressed. Press the Enter button while the message is being displayed and enter the correct password to gain access to the menu. After exiting the programming mode, the meter returns to its password protected condition.

Setup and Programming

Disabling Password Protection

To disable the password protection, access the *Password* menu and enter the correct password twice, as shown below. The meter is now unprotected until a new password is entered.

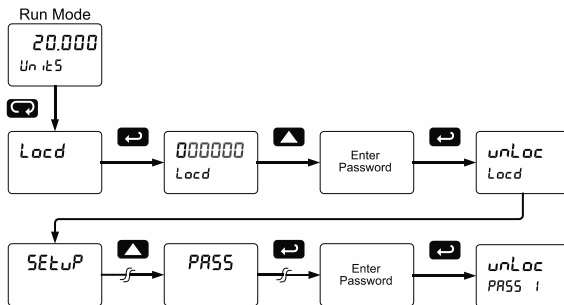

If the correct six-digit password is entered, the meter displays the message *unLoc* (*unlocked*) and the protection is disabled until a new password is programmed.

If the password entered is incorrect, the meter displays the message *Locked* (Locked) for about two seconds, and then it returns to Run Mode. To try again, press Enter while the *Locked* message is displayed.


Did you forget the password?

The password may be disabled by entering a master password once. If you are authorized to make changes, enter the master password 508655 to unlock the meter.

Setup and Programming

Advanced Features Menu

To simplify the setup process, functions not needed for most applications are located in the *Advanced Features* menu. Press and hold the Menu button for three seconds to access the advanced features of the meter.

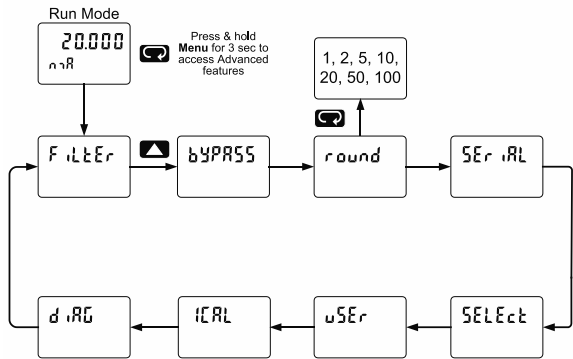

Advanced Features Menu & Display Messages

The following table shows the functions and messages of the *Advanced Features* menu in the order they appear in the menu.

Advanced Features Menu & Display Messages		
Display	Parameter	Action/Setting
Filter	Filter	Set noise filter value
bypass	Bypass	Set filter bypass value

Setup and Programming

Advanced Features Menu & Display Messages

Display	Parameter	Action/Setting
<i>round</i>	<i>Round</i>	Set the rounding value for display variables
<i>SELEct</i>	<i>Select</i>	Enter the Select menu (function, cutoff, out)
<i>FunctiOn</i>	<i>Input signal conditioning</i>	Select linear, square root, programmable exponent, or round horizontal tank function
<i>LiNEAR</i>	<i>Linear</i>	Set meter for linear function and select number of linearization points
<i>PV 1</i>	<i>PV1</i>	Select PV1 number of linearization points
<i>PV 2</i>	<i>PV2</i>	Select PV2 number of linearization points
<i>no PtS</i>	<i>Number of points</i>	Set PV1 for 2 to 32-point linearization Set PV2 for 2 to 8-point linearization
<i>SqUARE</i>	<i>Square root</i>	Set meter for square root extraction
<i>ProG E</i>	<i>Programmable exponent</i>	Set meter for programmable exponent and enter exponent value
<i>rhE</i>	<i>Round horizontal tank</i>	Set meter for round horizontal tank volume calculation
<i>inch</i>	<i>Dimension</i>	Calculate volume in gallons
<i>litr</i>	<i>Dimension</i>	Calculate volume in liters
<i>dIAmETER</i>	<i>Diameter</i>	Enter the tank's diameter in inches
<i>LEnGth</i>	<i>Length</i>	Enter the tank's length in inches
<i>CuToFF</i>	<i>Cutoff</i>	Set low-flow cutoff
<i>AnaLogue Pr</i>	<i>Analog output programming</i>	Program analog output parameters
<i>Source</i>	<i>Source</i>	Select source for the 4-20 mA output
<i>OverRanG</i>	<i>Overrange</i>	Program mA output for display overrange
<i>UnderRanG</i>	<i>Underrange</i>	Program mA output for display underrange

Setup and Programming

Advanced Features Menu & Display Messages

Display	Parameter	Action/Setting
בר ERH	<i>Break</i>	Set analog output value if input loop break is detected
הרH	<i>Maximum</i>	Program maximum mA output allowed
הרH	<i>Minimum</i>	Program minimum mA output allowed
ערL בר	<i>Calibrate</i>	Calibrate 4-20 mA output (internal reference source used for scaling the output)
4 הרH	<i>4 mA output</i>	Enter mA output value read by milliamp meter with at least 0.001 mA resolution
20 הרH	<i>20 mA output</i>	Enter mA output value read by milliamp meter with at least 0.001 mA resolution
ו5Er	<i>User Inputs</i>	Assign function keys and F4 function (digital input)
F1	<i>F1 function key</i>	Assign F1 function key
F2	<i>F2 function key</i>	Assign F2 function key
F3	<i>F3 function key</i>	Assign F3 function key
F4	<i>F4 function</i>	Assign F4 function (digital input)
ערL	<i>Internal source calibration</i>	Enter internal source calibration (used for scaling the meter without a signal source)
ערL	<i>Current calibration</i>	Calibrate 4-20 mA current input (internal reference source used for scaling the input)
ערL	<i>Current low</i>	Calibrate low current input (e.g. 4 mA)
ערH	<i>Current high</i>	Calibrate high current input (e.g. 20 mA)
ו ערL	<i>Voltage calibration</i>	Calibrate voltage input
ו ערL	<i>Voltage low</i>	Calibrate low voltage input (e.g. 0 V)
ו ערH	<i>Voltage high</i>	Calibrate high voltage input (e.g. 10 V)
ד.רג	<i>Diagnostics</i>	Display parameter settings

Setup and Programming

Advanced Features Menu & Display Messages

Display	Parameter	Action/Setting
LED t	LED test	Test all LEDs (press menu to exit test)
Inf	Information	Display software number and version
ErRSE	Erase	Erase Configuration SW stored in meter's memory

Noise Filter (F LLEr)

The noise filter is available for unusually noisy signals that cause an unstable process variable display. The noise filter averages the input signal over a certain period. The filter level determines the length of time over which the signal is averaged. The filter level can be set between 2 and 199. The higher the filter level, the longer the averaging time and so the longer it takes the display to settle to its final value. Setting the filter level to zero disables the filter function.

Noise Filter Bypass (bYPASS)

The noise filter bypass changes the behavior of the meter so that small variations in the signal are filtered out but large abrupt changes in the input signal are displayed immediately. The bypass value determines the minimum amount of signal change to be displayed immediately. All signal changes smaller than the bypass value are filtered or averaged by the meter. The noise filter bypass may be set between 0.1 and 99.9% of full scale.

Setup and Programming

Rounding Feature (**r**ound)

The rounding feature is used to give the user a steadier display with fluctuating signals. Rounding is used in addition to the filter function.


Rounding causes the display to round to the nearest value according to the rounding selected. See examples below:

Rounding Selection	Actual Value	Display Value	Actual Value	Display Value
1	12.022	12.022	12.023	12.023
5	12.022	12.020	12.023	12.025
10	12.024	12.020	12.025	12.030

Setup and Programming

Select Menu (SELEct)

The *Select* menu is used to select the input signal conditioner applied to the input (linear, square root, programmable exponent, or round horizontal tank), low-flow cutoff, and analog output programming. The multi-point linearization is part of the linear function selection.

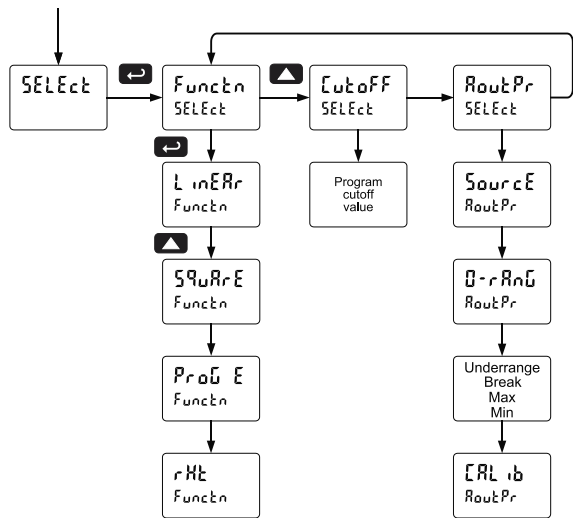

Setup and Programming


Input Signal Conditioning (*Function*)

The *Function* menu is used to select the input signal conditioner applied to the input: linear, square root, programmable exponent, or round horizontal tank volume calculation. The multi-point linearization is part of the linear function selection.

Meters are set up at the factory for linear function with 2-point linearization. The linear function provides a display that is linear with respect to the input signal.

Square Root Linearization (*SqurE*)

The square root function can be used to linearize the signal from a differential pressure transmitter and display flow rate in engineering units.

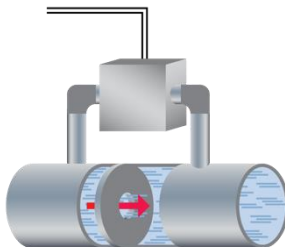

Programmable Exponent Linearization (*ProE*)


The programmable exponent can be used to linearize the signal from level transmitters in open-channel flow applications using weirs and flumes.

Setup and Programming

Multi-Point Linearization (L inERr)

Meters are set up at the factory for linear function with 2-point linearization. Up to 32 linearization points can be selected for PV1 under the linear function. The multi-point linearization can be used to linearize the display for non-linear signals such as those from level transmitters used to measure volume in odd-shaped tanks or to convert level to flow using weirs and flumes with complex exponent.


If the dual-scale level feature has been selected, the menus for PV1 & PV2 are enabled. PV2 can be programmed with up to 8 linearization points.

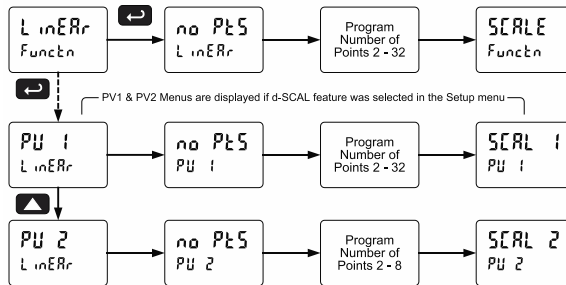


Setup and Programming

Round Horizontal Tank Linearization (rht)

This function automatically calculates the volume in a round horizontal tank with flat ends.

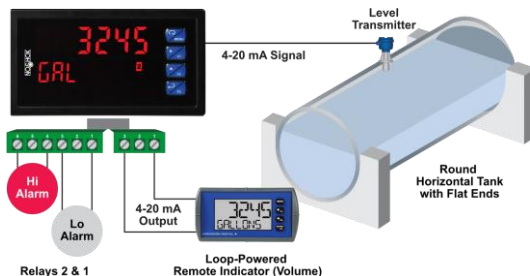

Set the display for the desired decimal point and engineering units before entering the round horizontal tank function. Select units, inches or cm for the tank dimensions. Enter the diameter and the length in inches and the results are calculated automatically in US gallons. Enter the diameter and length in cm and the results are calculated automatically in liters. The meter can be scaled to display the volume in any engineering unit.

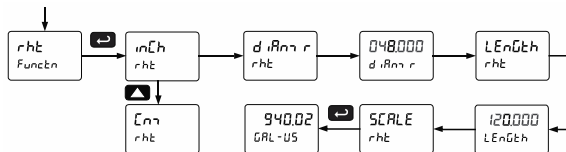

Note: After Scale is displayed continue pressing the Enter button until the meter completes the scaling of the input and display values.

Setup and Programming

Changing the Volume from Gallons to Liters

In the above graphic, entering the 48" for the diameter and 120" for the length of the round horizontal tank, the meter automatically calculates that the volume of the tank is 940.02 gallons.

1. Convert gallons to liters
1 US gallon = 3.7854 L
940.02 gal = 3558.4 L
2. Go to the *Setup* menu and change the decimal point to 1 decimal.
3. Go to the *Program – Scale* menu and press Enter until $\div 1.5 \div$ is shown on the main display.
4. Press Enter and change the display 2 value to 3558.4.
5. The meter is now displaying the volume in liters.

Note: The display can be scaled to display the volume in any engineering units.

Another way to display the volume in liters is to enter the dimensions in cm. The meter automatically calculates the volume in liters.

Low-Flow Cutoff (CutoffF)

The low-flow cutoff feature allows the meter to be programmed so that the often-unsteady output from a differential pressure transmitter, at low flow rates, always displays zero on the meter.

The cutoff value may be programmed from 0.1 to 999999. The meter will display zero below the cutoff value. Programming the cutoff value to zero disables the cutoff feature. The cutoff can be disabled to display negative values.

Setup and Programming


Analog Output Programming (AoutPr)

The *Analog Output Programming* menu is used to program the behavior of the 4-20 mA output. The following parameters and functions are programmed in this menu:

1. Source: Source for generating the 4-20 mA output (e.g. PV)
2. Overrange: Analog output value with display in overrange condition
3. Underrange: Analog output value with display in underrange condition
4. Break: Analog output value when loop break is detected
5. Max: Maximum analog output value allowed regardless of input
6. Min: Minimum analog output value allowed regardless of input
7. Calibrate: Calibrate the internal 4-20 mA source reference used to scale the 4-20 mA output

Analog Output Source

The source for generating the 4-20 mA output may be assigned to the process variable, maximum or minimum value reached by the process, or one of the set points.

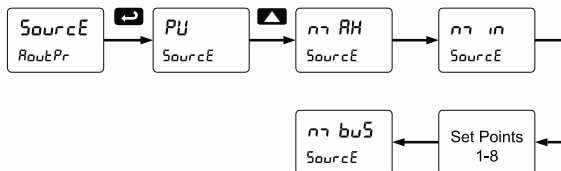

Analog Output Value for Loss of 4-20 mA Input (Loop Break)

The AoutPr - Break menu is used to force the analog output to go to a user-specified mA value if a break condition is detected in the 4-20 mA input loop. Selecting Ignore causes the mA output to go to the minimum value.

Setup and Programming

Analog Output Calibration

To perform the analog output calibration, it is recommended to use a milliamp meter with a resolution of at least 0.1 μA to measure the output current. The values saved internally during this procedure are used for scaling the 4-20 mA output in the *Setup* menu.


Analog Output Calibration Procedure

1. Wire the IDE30 4-20 mA output to a current loop that includes a power supply (internal or external 12 to 24 VDC), and the mA input on the digital meter. See *Figure 20. 4-20 mA Output Connections* on page 41 for details.
2. Turn on all devices. Allow for a 15 to 30 minute warm-up.
3. Go to the Advanced Features menu, and navigate to the Analog Output Programming (RoutPr) → Calibration (LR b) menu and press **Enter**.
4. The display will show 4 mA. The IDE30 mA output should now be close to 4 mA. Press Enter and the display will show 04.000. Enter the actual value read by the digital mA meter and press **Enter**.
5. The display will show 20 mA. The IDE30 mA output should now be close to 20 mA. Press **Enter** and the display will show 20.000. Enter the actual value read by the digital mA meter and press **Enter**.
6. The meter will now calculate the calibration factors and store them.
7. Press **Menu** to exit and return to Run mode.

Setup and Programming

Programmable Function Keys User Menu (uSEr)

The *User* menu allows the user to assign the front panel function keys F1, F2, and F3, and the F4 digital input (located on the input signal connector) to access most of the menus or to activate certain functions immediately (e.g. reset max & min, hold relay states, etc.). This allows the meter to be greatly customized for use in specialized applications.

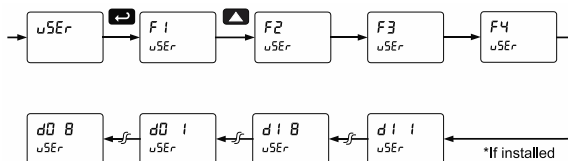

Function Keys & F4 Digital Input Available Settings

Refer to the following table for descriptions of each available function key or F4 digital input setting.

Function Keys & F4 Digital Input Available Settings	
Display	Description
rSt Hi	Reset the stored maximum display value
rSt Lo	Reset the stored minimum display value
rSt HL	Reset the stored maximum & minimum display values
tRrE	Capture tare and zero the display
rSt tr	Reset captured tare and resume normal operation
rELAY	Directly access the relay menu
SEt 1*	Directly access the set point menu for relay 1 (*through 4)

Setup and Programming

Function Keys & F4 Digital Input Available Settings	
Display	Description
$rLY\ d$	Disable all relays until a button assigned to <i>enable relays</i> ($rLY\ E$) is pressed
$rLY\ E$	Enable all relays to function as they have been programmed
$\overline{H}oLd$	Hold current relay states and analog output as they are until a button assigned to <i>enable relays</i> ($rLY\ E$) is pressed
$d\ HoLd$	Hold the current display value, relay states, and analog output momentarily while the function key or F4 digital input is active. The process value will continue to be calculated in the background.
$Ln\ l\ H\lrcorner$	Display maximum display value on line 1
$Ln\ l\ Lo$	Display minimum display value on line 1
$Ln\ l\ HL$	Display maximum & minimum display values on line 1
$Ln2\ H\lrcorner$	Display maximum display value on line 2
$Ln2\ Lo$	Display minimum display value on line 2
$Ln2\ HL$	Display maximum & minimum display values on line 2
$F\ \overline{O}n\ i^*$	Force relay 1 (*through 4) into the on state.
$\overline{C}ontrL$	Directly access the control menu
$d\ iSAbL$	Disable the selected function key or F4 Terminal
RcH	Acknowledge all active relays that are in a manual operation mode such as auto-manual or latching
$rESEt$	Directly access the reset menu

Setup and Programming

The tare function zero's out the display. In the case of scale weight, tare is used to eliminate container weight and provide net weight readings. There are two tare functions; Capture Tare and Reset Tare.

When the capture tare function is used, the display reading is offset by the displayed amount to make the displayed value zero. This modified display value is the net value. The originally displayed value without the tare offset is the gross value. Both may be chosen as a display option.



Reset tare removes the display offset of the net value, and the gross and net values become the same until a new capture tare is entered.

Setup and Programming

Internal Source Calibration (ICRL)

The meter is **factory calibrated** prior to shipment for milliamps and volts with calibration equipment that is certified to NIST standards.

The use of calibrated signal sources is necessary to calibrate the internal source of the meter. The meter's internal source is what allows the user to scale the meter without applying a signal.

Check calibration of the meter at least every 12 months. Each input must be recalibrated separately.

Notes:

1. *If meter is in operation and it is intended to accept only one input type (e.g. 4-20 mA), recalibration of other input is not necessary.*
2. *Allow the meter to warm up for at least 15 minutes before performing the internal source calibration procedure.*

Setup and Programming

The *Internal calibration* menu is part of the *Advanced Features* menu.


1. Press and hold the Menu button for three seconds to access the advanced features of the meter.
2. Press the Up arrow button to scroll to the *Internal calibration* menu ($\text{f}\text{E}\text{RL}$) and press Enter.
3. The meter displays either current calibration ($\text{f}\text{E}\text{RL}$) or voltage calibration ($\text{V}\text{E}\text{RL}$), according to the input setup. Press Enter to start the calibration process.

Example of *Internal Calibration* for current input:

4. The meter displays *low* input current message ($\text{f}\text{E}\text{Lo}$). Apply the low input signal and press Enter. The display flashes for a moment while the meter is accepting the low input signal.
5. After the display stops flashing, a number is displayed with the leftmost digit brighter than the rest. The bright digit is the active digit that can be changed by pressing the Up arrow button. Press the Right arrow button to move to the next digit.
6. Set the display value to correspond to the input signal being calibrated, typically 4.000 mA.
7. The display moves to the *high* input calibration ($\text{f}\text{E}\text{Hi}$). Apply the high input signal and press Enter.
8. Set the display for the high input calibration, in the same way as it was set for the low input calibration, typically 20.000 mA.

Setup and Programming

The following graphic shows the calibration of the current input. The voltage input is calibrated in a similar way.

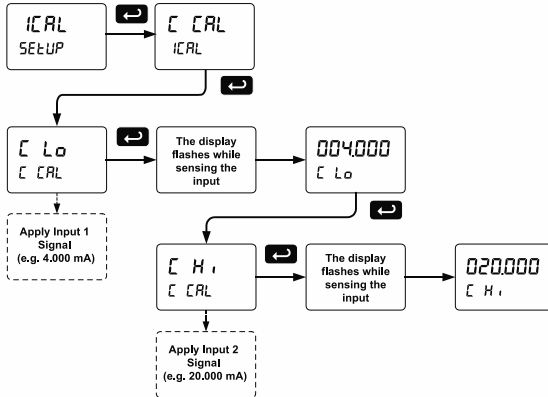

Tips:

- Low and high input signals can be any valid values within the range of the meter.
- Observe minimum input span requirements between input 1 and input 2.
- Low input should be less than high input signal. However, the low display can be higher than the high display (i.e. 4-20 mA = 100.0 to 0.0).

Setup and Programming

Error Message (Error)

An error message indicates that the calibration or scaling process was not successful.

After the error message is displayed, the meter reverts to the input prior to the failure during calibration or scaling and to input 1 during internal calibration, allowing the appropriate input signal to be applied or programmed.

The error message might be caused by any of the following conditions:

1. Input signal is not connected to the proper terminals or it is connected backwards*.
2. Wrong signal selection in *Setup* menu*.
3. Minimum input span requirements not maintained.
4. Input 1 signal inadvertently applied to calibrate input 2*.

**Not relevant when scaling the meter.*

Minimum Input Span

The minimum input span is the minimum difference between input 1 and input 2 signals required to complete the calibration or scaling of the meter.

Input Range	Input 1 & Input 2 Span
4-20 mA	0.15 mA
±10 VDC	0.10 VDC

Setup and Programming





Meter Operation

The meter is capable of accepting current (0-20 mA, 4-20 mA) and voltage signals (0-5 V, 1-5 V, 0-10 V, ± 10 V) and displaying these signals in engineering units from -99999 to 999999 (e.g. a 4-20 mA signal could be displayed as -50.000 to 50.000).

The dual-line display can be customized for the user's specific application. Typically, the main display is used for the process variable; while the second display is used for engineering units, custom legend, or set point indication.

The analog input can be scaled to display the process in two different scales; for example: with $\frac{d}{d} \text{SRL}$ enabled, the main display could indicate level in feet and the second display could indicate the volume in gallons.

Front Panel Buttons Operation

Button Symbol	Description
	Press to enter or exit Programming Mode, view settings, or exit max/min readings
	Press to reset max/min readings or other parameter/function assigned through the <i>User</i> menu
	Press to display max/min readings or other parameter/function assigned through the <i>User</i> menu
	Press to acknowledge relays or other parameters/function assigned through the <i>User</i> menu

Setup and Programming

Function Keys Operation

During operation, the programmable function keys operate according to the way they have been programmed in the *Advanced Features – User* menu. See *Programmable Function Keys User Menu* (μ5Er) on page 105 for details.

The table above shows the factory default settings for F1, F2, and F3.

F4 Operation

A digital input, F4, is standard on the meter. This F4 terminal is programmed identically to function keys F1, F2, and F3. The input is triggered with a contact closure to COM, or with an active low signal. During operation, F4 operates according to the way it has been programmed in the *Advanced Features – User* menu. See *Programmable Function Keys User Menu* (μ5Er) on page 105 for details.

Setup and Programming

Maximum/Minimum Readings

The max & min readings (peak & valley) reached by the process can be displayed either continuously or momentarily:

1. Display briefly by assigning to the F1-F3 function keys or to the F4 terminal in the *User* menu.
2. Display continuously by assigning either display to max/min through the *Display* menu.


Any of the F1-F3 function keys (buttons) and the F4 terminal can be programmed to reset the max & min readings. The meters are set at the factory to display the max reading by pressing the Up arrow/F2 button and to use the Right arrow/F1 button to access the *Reset* menu.

To display max reading using function key with factory defaults:

1. Press Up arrow/F2 button to display maximum reading since the last reset/power-up.
2. To reset max/min press Right arrow/F1 button to access the Reset menu. The max & min displays are reset to actual values.
3. Press Menu to exit max/min display reading.

To display max/min readings continuously:

Assign either display to Max (d H), Min (d L), or toggle between Max and Min (d HL) every 10 seconds.

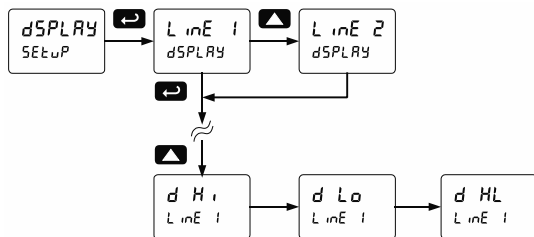

Setup and Programming

Troubleshooting

The rugged design and the user-friendly interface of the meter should make it unusual for the installer or operator to refer to this section of the manual. However, due to the many features and functions of the meter, it's possible that the setup of the meter does not agree with what an operator expects to see.

If the meter is not working as expected, refer to the *Diagnostics* menu and recommendations below.

Diagnostics Menu (d, RCL)

The *Diagnostics* menu is located in the *Advanced Features* menu, to access *Diagnostics* menu see *Advanced Features Menu* on page 93.

This menu allows the user to test the functionality of all the meter LEDs, check the meter's software and version information, and erase the Configuration Software installation files from the meter. Press the Enter button to view the settings and the Menu button to exit at any time. For a description of the diagnostic messages, see *Advanced Features Menu & Display Messages* on page 93.

Testing the Display LEDs

To test all LEDs on the display:

1. Go to the *Diagnostics* menu (d, RCL) and press Enter button.
2. Press Up arrow button and scroll to *LED Test* menu (LED t)
3. Press the Enter button to activate the LED Test. The meter will cycle through all digits, decimal points, and relay indicators to enable the operator to check that all LEDs are functioning properly.
4. Press the Enter button again to access the *Information* menu (INF a) or press the Menu button to return to Run Mode.

Setup and Programming

Determining Software Version

To determine the software version of a meter:

1. Go to the *Diagnostics* menu (d iAG) and press Enter button.
2. Press Up arrow button and scroll to Information menu (i n F o).
3. Press Enter to access the software number (S F t) and version (v E r) information. Write down the information as it is displayed. Continue pressing Enter until all the information is displayed.
4. The meter returns to Run Mode after displaying all the settings.


Setup and Programming

Reset Meter to Factory Defaults

When the parameters have been changed in a way that is difficult to determine what's happening, it might be better to start the setup process from the factory defaults.

Instructions to load factory defaults:

1. Enter the *Advanced Features* menu. See *Advanced Features Menu* on page 93.
2. Press Up arrow to go to *Diagnostics (d iAG)* menu
3. Press and hold Right arrow for three seconds, press Enter when display flashes *rESEt*.
Note: If Enter is not pressed within three seconds, the display returns to the Diagnostics menu.
4. The meter goes through an initialization sequence (similar as on power-up), and loads the factory default settings.

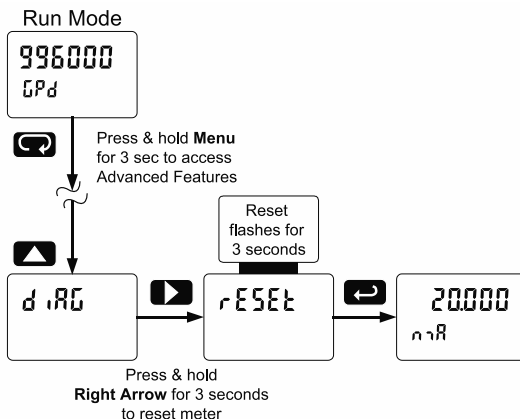

Setup and Programming

Factory Defaults & User Settings

The following table shows the factory setting for most of the programmable parameters on the meter.

Parameter	Display	Default Setting
Input type	INP _{ut}	4-20 mA
Dual-scale feature	d-5[RL	No (Single scale)
Filter	F ILtEr	70
Bypass	bYPASs	0.2
Function	FunctiOn	Linear
Number of points	no Pts	2
Programming	Prog	Scale
Input 1	INP 1	4.000 mA
Display 1	d IS 1	4.000
Input 2	INP 2	20.000 mA
Display 2	d IS 2	20.000
Decimal point	dddddd	3 places
Cutoff value	Cut oFF	0.0 (disabled)
Display assignment	d5PLRY	
Display Line 1	L INE 1	PV: Process variable
Display Line 2	L INE 2	Eng unit default= mA
Display intensity	d- INtY	6
Relay 1 action	Rct 1	Automatic

Setup and Programming

Parameter	Display	Default Setting
Relay 1 set point	SEt 1	1.000
Relay 1 reset point	rSEt 1	0.500
Relay 2 action	RcE 2	Automatic
Relay 2 set point	SEt 2	2.000
Relay 2 reset point	rSEt 2	1.500
Relay 3 action	RcE 3	Automatic
Relay 3 set point	SEt 3	3.000
Relay 3 reset point	rSEt 3	2.500
Relay 4 action	RcE 4	Automatic
Relay 4 set point	SEt 4	4.000
Relay 4 reset point	rSEt 4	3.500
Fail-safe relay 1	FLS 1	Off
Fail-safe relay 2	FLS 2	Off
Fail-safe relay 3	FLS 3	Off
Fail-safe relay 4	FLS 4	Off
On delay relay 1	On 1	0.0 sec
Off delay relay 1	OFF 1	0.0 sec
On delay relay 2	On 2	0.0 sec
Off delay relay 2	OFF 2	0.0 sec
On delay relay 3	On 3	0.0 sec
Off delay relay 3	OFF 3	0.0 sec
On delay relay 4	On 4	0.0 sec

Setup and Programming

Parameter	Display	Default Setting
Off delay relay 4	OFF 4	0.0 sec
Loop break relay 1	Ignore	Ignore
Loop break relay 2	Ignore	Ignore
Loop break relay 3	Ignore	Ignore
Loop break relay 4	Ignore	Ignore
Display 1 analog out	d 15 1	4.000
Output 1 value	Out 1	4.000 mA
Display 2 analog out	d 15 2	20.000
Output 2 value	Out 2	20.000 mA
Source analog output	Source	Process Variable
Overrange output	OverRng	21.000 mA
Underrange output	UnderRng	3.000 mA
Loop break output	brERR	1.000 mA
Maximum output	max	23.000 mA
Minimum output	min	1.000 mA
F1 function key	F 1	Reset max & min
F2 function key	F 2	Line 1: Max (Hi)
F3 function key	F 3	Acknowledge relays
F4 function	F 4	Acknowledge relays
Password 1	PRSS 1	000000 (unlocked)
Password 2	PRSS 2	000000 (unlocked)
Password 3	PRSS 3	000000 (unlocked)

Setup and Programming

Troubleshooting Tips

This meter is a highly sophisticated instrument with an extensive list of features and capabilities. If the front panel buttons are used to program the meter, it may be a difficult task to keep everything straight. That is why we strongly recommend the use of the free Configuration Software for all programming activities. A USB cable is provided with the meter for programming with Configuration Software.

If you have programmed the meter with the front panel buttons and it is not working as intended, try re-programming the meter using Configuration Software.

Symptom	Check/Action
No display at all	Check power at power connector
Not able to change setup or programming, <i>Locd</i> is displayed	Meter is password-protected, enter correct six-digit password to unlock or Master Password of 508655.
Meter does not respond to input change	If a <i>Low-Flow Cutoff</i> Value has been programmed, the meter will display zero below that point, regardless of the input – which can appear like the meter is not responding to an input change. Check to make sure the problem is not being caused by an undesired low-flow cutoff value. To prevent the display from showing a negative value, set the low-flow cutoff to a value greater than zero.
Meter displays error message during calibration (<i>Error</i>)	Check: 1. Signal connections 2. Input selected in <i>Setup</i> menu 3. Minimum input span requirements
Meter displays 1. 999999 2. -999999	Check: 1. Input selected in <i>Setup</i> menu 2. Corresponding signal at Signal connector

Setup and Programming

Display is unstable	Check: 1. Input signal stability and value 2. Display scaling vs. input signal 3. Filter and bypass values (increase)
Display response is too slow	Check filter and bypass values
Display reading is not accurate	Check: 1. Input signal conditioner selected: Linear, square root, etc. 2. Scaling or calibration
Display does not respond to input changes, reading a fixed number	Check: 1. Display assignment, it might be displaying max, min, or set point.
Display alternates between 1. H and a number 2. L and a number	Press Menu to exit max/min display readings.
Relay operation is reversed	Check: 1. Fail-safe in <i>Setup</i> menu 2. Wiring of relay contacts
Relay and status LED do not respond to signal	Check: 1. Relay action in <i>Setup</i> menu 2. Set and reset points
Flashing relay status LEDs	Relays in manual control mode
Meter not communicating with Configuration Software	1. Check USB connection 2. Make sure meter is not externally powered (AC or DC)
If the display locks up or the meter does not respond at all	Cycle the power to reboot the microprocessor.
Other symptoms not described above	Call Technical Support for assistance.

Setup and Programming

Note: Certain sequences of events can cause unexpected results. To solve these issues, it is best to start fresh from factory defaults and use the manual as a step by step programming guide, rather than a random approach to programming. To reset the meter to factory defaults, see Reset Meter to Factory Defaults on page 117. In addition, for best results, we recommend using the free Configuration Software for all programming needs.

NOSHOK Technical Support

Corporate Headquarters

1010 West Bagley Road

Berea, Ohio 44017

Ph: 440.243.0888

Fax: 440.243.3472

E-mail: noshok@noshok.com

Web: www.noshok.com

For the latest version of this manual please visit www.noshok.com