

# J-2000

owner's manual



**DELMHORST**<sup>®</sup>  
INSTRUMENT CO.

WHEN ACCURACY IS THE POINT.<sup>™</sup>




# TABLE OF CONTENTS

---

- 2 J-2000 Features
- 3 Before You Begin
- 3 Check Calibration
- 4 Set Species
- 5 Species Code Chart
- 6 Set Temperature
- 7 Set Pin Calibration
- 7 Taking a Reading
- 8 Information About Your Readings
  - 8 To Check Accumulated Readings
  - 8 To Reset Meter
- 9 Care of Your Meter
- 10 Service For Your Meter
- 11 Warranty

# DELMHORST J-2000

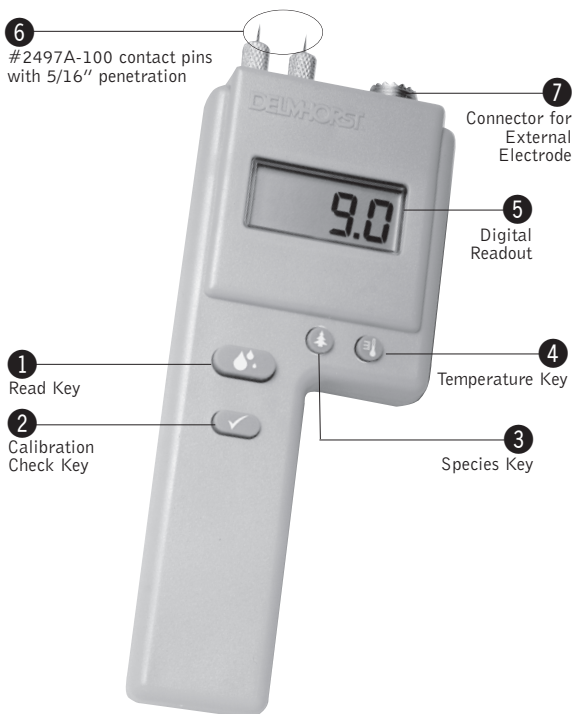

## J-2000 FEATURES

- ▶ Resistance technology recognized worldwide as the most accurate method for measuring wood MC
- ▶ 6% to 40% MC wood (J-2000)
- ▶ 6% to 60% MC wood (J-2000/X)
- ▶ Averages up to 100 accumulated readings
- ▶ User-selectable corrections for 48 species
- ▶ Built-in temperature compensation (F/C)
- ▶ Proven microcontroller circuit
- ▶ Easy one-hand operation
- ▶ Includes (1) 9-Volt Battery
- ▶ Includes sturdy carrying case
- ▶ One-year warranty

# BEFORE YOU BEGIN

---

## Key Functions

- 1 READ KEY - Press to read the %MC.
- 2 CALIBRATION CHECK KEY - This key, (when pressed with the read key) checks the meter calibration. It also displays the number of readings in memory (up to 100), the average, and the highest stored reading. It also clears the memory.
- 3 SPECIES KEY - Press to select the species code for the wood you are testing. Species are numbered from 1 to 48 and are listed on the Species Code Chart on page 5. To scroll forward through the species codes keep the species key pressed. To scroll backward press the species key, release it and immediately press the temperature key.
- 4 TEMPERATURE KEY - Press to set the wood temperature. Press and immediately press the Calibration Check the temperature key 2 to toggle between (F and C). To increase the temperature setting keep the temperature key pressed. To decrease the temperature, press the temperature key, release it and immediately press the species key.

## CHECK CALIBRATION

---

Press the calibration check key 2 and read key 1 simultaneously. Meter is in calibration if it displays 12% (+ or - 0.2).

If you check the calibration and the meter does not display 12% it is likely an indication of a low battery. If this occurs, replace the battery immediately with a new EverReady or Duracell brand 9V. Continued use with a low battery may cause the meter to go out of calibration. If you have a fresh battery and the instrument still does not indicate a proper calibration, return it to DELMHORST for service. See **Service for your Meter** section.

When the battery is removed and then reconnected, the meter displays its software version for one second and then turns itself off. After replacing the battery, you must reset the meter as described in **Resetting the Meter** section.

A hard Reset is required if, after changing the battery, the display is frozen. This is sometimes caused by the interruption of contact between the battery and battery lead wire. Resolve this as follows: Disconnect the battery. Press and hold the Read key for 15 seconds. Release the Read key. Press and hold the Check key for 15 seconds. Release the Check key. Connect a fresh battery to the lead wire in a single action, making sure to align the poles properly and without interrupting contact. If the display remains frozen, repeat the procedure. If this procedure does not solve the problem, refer to the Service for Your Meter section.

## Meter Default Settings

---

Species - Douglas Fir

Temperature - 70°F

Pin/Electrode - 4-pin (non-insulated)

Each of these parameters is programmed into the meter and is user-selectable. Proper setting of each will insure the most accurate readings.

## SET SPECIES

---

The J-2000 defaults to Species Code #1 - Douglas Fir - the USDA standard and basis for all Delmhorst calibrations. Because the electrical characteristics of different species vary, all species read differently at the same moisture content. For this reason you need to adjust for species. If you are working with a species other than Douglas Fir, set the species code using the species key **3**, and the meter will make the necessary corrections.

- ▶ **To change species** press the species key **3**. The meter will display the current species code for one second. Refer to the Species Code Chart on page 5.
- ▶ **To scroll forward** through the species list hold the species key **3** while the current species code is displayed and scroll to the species number desired.
- ▶ **To scroll backward** through the species list, press and release the species key **3**. Within one second, press and hold the temperature key **4**. Continue to hold the temperature button **4** and the species number will decrease.

- ▶ **When scrolling in either direction**, release the key to stop at your desired species.
- ▶ When working with a species or wood-based material that is not included in the species code chart, use the convenient Wood Species Correction Look-up on our website: <https://www.delmhorst.com/correction-tables#species>. You can also contact our customer service team if you need further assistance. It is always helpful if you have the scientific name as well as any common names for the species.

## Species Code Chart

CODE / SPECIES	CODE / SPECIES
1 Fir, Douglas	26 Mahogany, African (also Khaya)
2 Pine, Southern	27 Mahogany, Honduras
3 SPF	28 Mahogany, Philippine
4 Alder	29 Maple, Hard/Soft
5 Apitong	30 Meranti, Dark Red
6 Aspen	31 Oak, Red
7 Ash, White	32 Oak, White
8 Basswood	33 Pecan
9 Birch	34 Pine, Longleaf
10 Cedar, Eastern Red	35 Pine, Ponderosa
11 Cedar, Incense	36 Pine, Shortleaf
12 Cherry	37 Pine, Sugar
13 Cottonwood	38 Pine, White
14 Cypress	39 Poplar, Yellow
15 Elm, American	40 Ramin
16 Fir, Red	41 Radiata Pine
17 Fir, White	42 Redwood
18 Gum, Black	43 Spruce, Sitka
19 Gum, Red	44 SPF, COFI*
20 Hemlock, Western	45 Teak
21 Hackberry	46 Virola
22 Hickory	47 Walnut, Black
23 Keruing	48 Western Hemlock - COFI*
24 Larch	49 Advantech OSB Pine **
25 Magnolia	50 Advantech OSB Aspen **

\*Species and temperature correction data for both Western Hemlock-COFI (code #48) and SPF-COFI (code #44) were developed by COFI. When comparing readings between the model RDM-2/COFI or the RDM-2S/COFI, used with type 26-E electrode with insulated pins, and the J-2000, be sure both meters are set to 2-pin electrode (insulated pins).

\*\* Pine - mills 227, 229, 290

\*\* Aspen - mill 228

Data provided through collaboration between Delmhorst Instrument and Huber Engineered Woods. Corrections programmed in standard J-2000 only.

# SET TEMPERATURE

---



The J-2000 defaults to a temperature of 70°F. As wood temperature increases, its electrical resistance decreases and indicated moisture content rises. Lower wood temperatures result in lower indicated moisture content. A correction is necessary if the wood temperature is outside the range of 50°F (10°C) to 90°F (32°C). Set the temperature accordingly and the meter will make the correction.

- ▶ **To change temperature** press and release the temperature key **4**. The meter will display the current temperature for one second.
- ▶ **To scroll forward** through the temperature settings, press and hold the temperature key **4** while the current temperature is displayed.
- ▶ **To scroll backward** press and release the temperature key **4**. Within one second, press and hold the species key **3**. Continue to hold the species key **3** and the temperature will decrease.
- ▶ **When scrolling in either direction**, release the button to stop at the desired temperature.

## Set Temperature Mode

---

- ▶ **To change between Fahrenheit and Celsius modes** press the temperature key **4**.
- ▶ **Press the calibration check key 2** within one second and release when you are in the desired mode.
- ▶ **The meter will display the current temperature setting** in the new mode and will wait one more second until shutting off so that you may change the temperature value as described above.

If the meter is in Fahrenheit mode, the letter "F" will display in the left-hand corner. If it is in Celsius mode, no letter will appear in the display.

In the Fahrenheit mode, the temperature will change in increments of 5°F. In Celsius, the temperature will change in increments of either 2°C or 3°C depending on its conversion from Fahrenheit.

In the Fahrenheit mode, the temperature value will display in whole numbers. In the Celsius mode, positive values will display in whole numbers; negative values will display with a decimal point and a "minus" sign in the left-hand corner. (i.e.: -17.0)



# SET PIN CALIBRATION

---

The basic factory calibration of the J-2000 is for use with non-insulated pins. Insulated pins read lower than non-insulated ones. The difference is small below 10% MC but increases as the moisture content increases above 10%. When using an electrode with insulated pins, such as the 26-ES hammer electrode, you can change the calibration to compensate for this difference.

- ▶ **To change the pin setting**, press and release the species key **3**, then press the calibration check key **2** within one second.
- ▶ **The meter will display** the current pin calibration as either 222 for insulated or 444 for non-insulated pins.
- ▶ **If you continue to hold the calibration check key **2****, the meter will toggle between 222 and 444.

## TAKING A READING

---

- ▶ **Remove the protective cover** to expose the pins. Check that the contact pins **6** are firmly hand tightened.
- ▶ **To take a reading**, align the contact pins **6** parallel to the grain and push them to their full penetration into the wood, if possible. Insulated pins read only at the tip and can be driven to the desired depth.
- ▶ **Press the read key **1**** and read the moisture content on the meter scale. The meter displays the %MC for two seconds.
- ▶ **To add a reading** to the sum of all the previously stored readings, release the read key **1** within 2 seconds.

The non-insulated contact pins on the top of the meter penetrate max 5/16in. and may be used on wood up to 1-1/2 to 2in. thick. Push the pins into the wood to their full penetration for best accuracy. For thicker wood and hardwoods over 4/4, use the 26-ES hammer electrode with insulated pins. These pins (no. 496), may be used on wood up to 5-6in. thick.

Connect the electrode to the input connector on the top of the meter **7**. Contact our customer service team for more information on other available pins for your application.

Insulated pins offer the advantage of taking measurements at various depths since the reading is made at the point in the wood where only the non-insulated tips of the pins make contact. This is especially useful when drying lumber since reliable shell and core readings are essential to producing high quality lumber.

See the FAQ section of our website for helpful application info. [www.delmhorst.com](http://www.delmhorst.com)

# INFORMATION ABOUT YOUR READINGS

---

Readings below 6% will be displayed as a numeric value, (-##.#), but will not be added to the accumulated readings in memory. Readings below 6% due to temperature and species adjustments will be shown as a numeric value with no minus sign. These readings will be added to the accumulated total in memory and included in the statistical calculations.

Readings above 40% are always displayed as 999 and are not added to the memory.

The meter will accumulate up to 100 readings. After all 100 readings are stored it will not add new readings until the memory has been cleared. It will also continue to display the average of all 100 readings as a reminder that the memory is full.

When taking and storing readings for a specific wood species, be sure to clear the meter's memory before moving on to the next species if you do not want to group all of the readings together.

## TO CHECK ACCUMULATED READINGS

---

This feature allows you to view the total number of all accumulated readings, the average of those readings, and the highest stored reading.

- ▶ **To view the readings** press and release the calibration check key **2**. The meter displays the number of accumulated readings for one second, then the average of those readings for two seconds. Then it displays the highest stored reading for two seconds. The total cycle time is five seconds.
- ▶ **To clear the memory** press and hold the calibration check key **2** down for 5 seconds. All accumulated readings will be erased and the meter will display "0".

## TO RESET METER

---

- ▶ **Press and release the calibration check key **2**.**
- ▶ **Within one second press the species key **3**.**
- ▶ **The meter will reset itself and display "170"** to indicate the meter is reset to default: Species #1 (Douglas Fir) at 70°F, followed by 444 (pin setting). All of the readings in memory will be cleared.

# CARE OF YOUR METER

---

To keep your meter in good working order:

- ▶ Store your meter in a clean, dry place. The protective carrying case provided is an ideal storage place when the meter is not in use.
- ▶ Change the 9-Volt battery as needed. Use only EverReady or Duracell brand batteries. Continued use with a low battery may cause the meter to go out of calibration.
- ▶ Change contact pins as needed. Keep contact pins hand tightened.
- ▶ Clean the meter and contact pins with any biodegradable cleaner. Use the cleaner sparingly and on external parts only. Keep cleaner out of the external connector **7**.
- ▶ Remove the battery if the meter will not be used for one month or longer.

## SERVICE FOR YOUR METER

---

If your meter is not working properly, replace the battery with a new one and check the calibration. If this does not resolve the problem please send your meter back to Delmhorst for repair.

Go to [www.delmhorst.com](http://www.delmhorst.com) and click on Support and then download the Return Form.

If you require further assistance please call 877-DELMHORST (335-6467) or 973-334-2557.

E-mail [info@delmhorst.com](mailto:info@delmhorst.com)

# WARRANTY

---

Delmhorst Instrument Co., referred to hereafter as Delmhorst, guarantees its J-2000 meter for one year from date of purchase and any optional electrodes against defects in material or workmanship for 90 days. If, within the warranty period, you find any defect in material or workmanship return the meter following the instructions in the **Service for Your Meter** section. This limited warranty does not cover abuse, alteration, misuse, damage during shipment, improper service, unauthorized or unreasonable use of the meter or electrodes. This warranty does not cover batteries or contact pins. If the meter or any optional electrodes have been tampered with, the warranty shall be void. At our option we may replace or repair the meter.

Delmhorst shall not be liable for incidental or consequential damages for the breach of any express or implied warranty with respect to this product or its calibration. With proper care and maintenance the meter should stay in calibration; follow the instructions in the **Care of Your Meter** section.

UNDER NO CIRCUMSTANCES SHALL DELMHORST BE LIABLE FOR ANY INCIDENTAL, INDIRECT, SPECIAL, OR CONSEQUENTIAL DAMAGES OF ANY TYPE WHATSOEVER, INCLUDING, BUT NOT LIMITED TO, LOST PROFITS OR DOWNTIME ARISING OUT OF OR RELATED IN ANY RESPECT TO ITS METERS OR ELECTRODES AND NO OTHER WARRANTY, WRITTEN, ORAL OR IMPLIED APPLIES. DELMHORST SHALL IN NO EVENT BE LIABLE FOR ANY BREACH OF WARRANTY OR DEFECT IN THIS PRODUCT THAT EXCEEDS THE AMOUNT OF PURCHASE OF THIS PRODUCT.

The express warranty set forth above constitutes the entire warranty with respect to Delmhorst meters and electrodes and no other warranty, written, oral, or implied applies. This warranty is personal to the customer purchasing the product and is not transferable.

# NOTES

---



**F**or more than 70 years Delmhorst Instrument has been the leading manufacturer of high quality, US-made moisture meters and thermo-hygrometers.

Today we offer a wide range of meters for applications including water damage restoration, construction, flooring, lumber/woodworking, paper, and agriculture.

**DELMHORST**  
===== INSTRUMENT CO. =====

WHEN ACCURACY IS THE POINT.™

51 Indian Lane East  
Towaco, NJ 07082

(877)-DELMHORST  
[www.delmhorst.com](http://www.delmhorst.com)  
[info@delmhorst.com](mailto:info@delmhorst.com)

©2006, Delmhorst Instrument Co.

510INS-0003

REV. 11/18