



# Clamp-on Power Meter

## □VV1□

A Simple Yet A Powerful Power Measuring Tool.

#### **Features**


- AC / DC Power up to 600 kW
- True RMS for AC .
- Harmonics 1st to 25th order
- Power fluctuation using the ACA Inrush and Peak hold functions.
- AC / DC Voltage max. 1000 V
- AC / DC Current max. 600 A
- Frequency, Resistance, Continuity, Diode check, Power factor.
- Up to 9999 counts, approx. 37mm max. diameter of measurable conductor (the jaw opens approx. 45mm max.)

#### For Safety

■ CATIV 600V and CATIII 1000V compliant.

#### **Useful Functions**

- Backlight on the display area turns on and a white LED automatically illuminates the front of jaw when clamping.
- Non-contact Voltage Detection (Red LED lights up on detection).
- Easy Operation with the Navigator key.
- Low Pass Filter, Phase Detection, AC / DC Auto Sense.

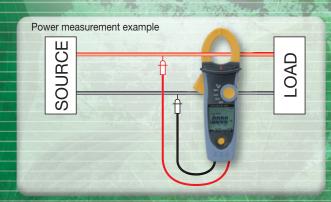



<URL: tmi.yokogawa.com>

## **Application**

## ■ Inrush Current Measurement Method 10.0A Inrush current Figure 1 Small motor Figure 2 0.04 Time Motor On Inrush AC current Displays RMS value of 100ms period. INRUSH nn A

#### **Explanation**

A function to measure inrush current is available. This function allows you to easily measure inrush current that occurs when starting a motor, relay, or the like. Just clamp the CW10 to the motor and set INRUSH before starting the motor to automatically measure and hold the inrush current that occured in 100 ms period (Figure 2).

#### What is inrush current?

Starting current or inrush current is the instantaneous electrical current that flows when the power is initially turned on.

## **Specifications**

Accuracy 23±5°C, 80%RH or less Accuracy: ±(% of reading + digits)

Rms-value detection

· o.tago				
	Function	Range	Resolution (Maximum reading)	Accuracy*
	DCV	100 V	99.99 V	0.7% + 2
ı	DCV	1000 V	999.9 V	0.770 + 2
	ACV	100 V	99.99 V	1.0% + 5
	ACV	1000 V	999.9 V	50 ~ 500Hz
	LPF ACV	100 V	99.99 V	50 ≤ f ≤ 60Hz: 1.0% + 5
		1000 V	999.9 V	60 < f ≤ 400Hz: 5.0% + 5

\* DCV<1000 digits: add 6 digits to accuracy ACV<1000 digits: add 3 digits to accuracy Maximum input voltage: 1000 Vms, 1414.2 Vpk Input impedance: approx. 3.5 MD, <100 pF AC+DC Vms accuracy=ACV accuracy + DCV accuracy

ctor effects < CF  $\le$  2.0: add 1.0% of reading to accuracy < CF  $\le$  2.5: add 2.5% of reading to accuracy < CF  $\le$  3.0: add 4.0% of reading to accuracy m input voltage: 690 Vrms CF=2 460 Vrms CF

#### Current

Rms-value detection

Function	Range	Resolution (Maximum reading)	Accuracy*	
DOA	100 A	99.99 A	1.5% + 20	
DCA	600 A	600.0 A***	1.5% + 5*	
ACA	100 A**	99.99 A	50 ≤ f ≤ 60Hz : 1.5% + 5*	
ACA	600 A	600.0 A***	60 < f ≤ 400Hz : 2.0% + 5*	
	50 ≤ f ≤ 60Hz : 1.5% + 5			
	600 A	600.0 A***	60 < f ≤ 400Hz: 5.0% + 5	

"The measured value <1000 digits: add 5 digits to accuracy 
"Injut current ≥ 0.10 A at 100 A range of ACA and LPF ACA 
"160 A : Quaranteed accuracy (not maximum reading) 
Maximum injut current: 600 Arms, 848.5Apk 
Conductor position effects: ±1.0% of reading 
AC+DC Arms accuracy=ACA accuracy + DCA accuracy b

Crest factor effects
14 < CF < 2.0: add 1.0% of reading to accuracy
2.0 < CF < 2.5: add 2.5% of reading to accuracy
2.5 < CF < 3.0: add 4.5% of reading to accuracy
Asymum input current: 420 Arms CF=2 280 Arms CF=3

#### Peak Hold (AC mode only)

Function	Range	Resolution (Maximum reading)	Accuracy
ACV	100 V	140.0 V	3.0% + 15
ACV	1000 V	1400 V	3.0% + 15
ACA	100 A	140.0 A	2.00% - 15
ACA	600 A	850 A	3.0% + 15

PEAK MAX: polarity+, polarity-Maximum input voltage and current: 1000 Vrms, 600 Arms Sine wave, ACV ≥ 5 Vrms, ACA ≥ 5 Arms, 50 to 400 Hz continuous wave

rrequericy (riz)		
Function	Resolution (Measuring range)	Accuracy
100 Hz	20.00 to 99.99 Hz	
1000 Hz	20.0 to 999.9 Hz	0.5% + 3
10 kHz	0.020 to 9.999 kHz	]

Maximum input voltage and current: 1000 Vrms, 600 Arms Input condition; 100 V range: 10 to 100 Vrms (Sine wave) 1000 V range: 10 to 100 Vrms 1000 V range: 10 to 100 Vrms (>400 V range: 10 V ra

#### **Harmonic Measurement**

	individual Harrionio		
	Harmonic order	Resolution (Maximum reading)	Accuracy
	1st to 12th (h01- h12) 13th to 25th (h01- h12)	99.9 %	5% + 10
		99.9 %	10% + 10

Maximum input voltage and current: approx. 1000 Vrms, 600 Arms The "rdy" is displayed at ACV < 10 Vrms, ACA < 10 Arms The "OutF" is displayed at f < 45, 65 < f (f: fundamental frequency)

#### Inrush Current

Function	Range	Resolution (Maximum reading)	Accuracy
ACA	100 A	99.99 A	2.5% + 20
AUA	600 A	600.0 A*	2.5% + 5

Maximum input current: approx. 600 Arms
\*600 A: Guaranteed accuracy (not maximum reading)
100A range: ACA1 ≥ 10 Arms (Sine wave, 50Hz/60Hz)

600A range: ACA  $\geq$  100 Arms (Sine wave, 50Hz/60Hz) Measurement time: approx. 100ms

Cuve i owei			
Function	Range	Resolution (Maximum reading)	Accuracy
	10 kW	9.999 kW*	
ACW DCW	100 kW	99.99 kW	ACW: 2.5% + 11** DCW: 2.2% + 22**
DOW	600 kW	600 U KW**	DOVV. 2.270 T 22

The measured value < 1.000kW: add 10digits to the accuracy.
"Conditions of accuracy (combination of Voltage and Current range)
10 kW range: 100 V and 100 A
100 kW range: 100 V and 600 A or 1000 V and 100 A
600 kW range: 1000V and 600 A or 1000 V and 100 A
600 kW range: 1000V and 600 A
Other combinations:
Accuracy: (Current accuracy-Voltage reading) + (Voltage accuracy-Voltage reading)

\*\*600 kW : Guaranteed accuracy (not maximum reading)
Maximum input voltage and current: 1000 Vrms, 600 Arms
ACW: ACV ≥ 10 Vrms and ACA ≥ 5 Arms (Sine wave, 50 ≤ f
≤ 60Hz, PF=1.00)
DCW: at DCV ≥ 10 V and DCA ≥ 5 A

#### Power Factor

Function	Resolution (Measuring range)	Accuracy
Power factor	-1.00~0.00~1.00	±(3°+2digits)

Maximum input voltage and current: 1000 Vrms, 600 Arms PF: ACV  $\geq$  10 Vrms and ACA  $\geq$  5 Arms (Sine wave, 50  $\leq$  f  $\leq$  60Hz)

#### Resistance/Continuity check

neolotanoo, continuity oneok			
Function	Range	Resolution (Maximum reading)	Accuracy
Resistance $\Omega$	1000 Ω	999.9 Ω	1.0% + 5
	10 kΩ	9.999 kΩ	1.0% + 3
	100 kΩ	99.99 kΩ	
Continuity check	1000 Ω	999.9 Ω	1.0% + 5
	The buzzer turns of approx. 100msec)	n for resistances lower than appro	ox. 30Ω. (Response time:

Maximum input voltage: 1000 Vrms Maximum test current: approx. 0.5mA Open circuit voltage: approx. 3V

#### **Diode Test**

	Function	Resolution (Measuring range)	Accuracy
[	Diode Test	0.40~0.80 V	±0.1 V

Maximum test current: approx. 0.5mA Open circuit voltage: approx. 1.8V

#### **General Specifications**

Display count:
Measuring rate:
Over range indicator:
Auto Power Off:
Low-battery indicator:
Power supply: 9999 / 6000 9999 / 6000
3 times / sec.
"OL" or "-OL"
Approx. 15 minute.
(four steps)
9V alkaline battery (6LR61)

Power supply:

Power supply:

Battery life:

When using alkaline battery (6LR61)

When using alkaline battery, backlight off
Approx. 20 hours

Operating temperature and humidity: 0 − 50 °C (with no condensation)
≤ 80% RH (0 − 30 °C)
≤ 75% RH (30 − 40 °C)
≤ 45% RH (40 − 50 °C)

Temperature coefficient: At 0 to 18 °C and 28 to 50 °C

Add 23±5 °C accuracy x 0.2 / °C

Storage temperature:

Withstand voltage:

Withstand voltage:

Withstand voltage:

AC 6880 Vrms 5 sec. (between the core and the case)

AC 6880 Vrms 5 sec.
(between the core and the voltage input terminals)

AC 6880 Vrms 5 sec.
(between the voltage input terminals and the case)

100MΩ or greater at 1000 VDC
(between the core and the case, the core and the voltage input terminals and the voltage input terminals and the voltage input terminals and the case)

terminals and the voltage input terminals and the case)

Compliant standards: Safety standards:

EN 61010-1, EN 61010-2-032 1000V CAT.III, 600V CAT.IV EN 61010-031 (the test leads) Pollution degree 2, Indoor use, Altitude 2000m or less EN 61326-1, EN 61326-2-1, EN 61326-2-2, EMC standards:

FN 55011

EN 55011
Approx 87.5 mm(W) x 242 mm(L) x 51 mm(D)
conductors: φ37mm (Maximum)
Approx. 435g (including the battery)
Test leads 1set (Red and Black) Dimensions Diameter of measurable Weight:
Accessories:

Carrying case 9V alkaline battery (6LR61) User's Manual

Accessories (Sold Separtely): Lead with Alligator Clip Model code 99014



#### YOKOGAWA METERS & INSTRUMENTS CORPORATION

Global Sales Dept. /Phone: +81-42-534-1413 Facsimile: +81-42-534-1438

E-mail: tm@cs.jp.yokogawa.com

YOKOGAWA CORPORATION OF AMERICA YOKOGAWA FUROPE B V YOKOGAWA ENGINEERING ASIA PTE. LTD.

Phone: (1)-770-253-7000, Fax: (1)-770-254-0928 Phone: (31)-88-4641000, Fax: (31)-88-4641111 Phone: (65)-62419933, Fax: (65)-62412606

Subject to change without notice. [Ed: 02/b] Copyright @2011 Printed in Japan, 109(KP)